Leader in Electrics & Automation

Meta-MEC

Manual Motor Starters

Electric Equipment

LS Industrial Systems
www.lsis.biz

LS Meta-MEC Manual Motor Starters provide completed ranges up to 100A

32AF

0.1~0.16... 28~40A (17 step)

MMS-32S

- Standard

MMS-32H
MMS-32HI

- High break
- Magnetic release

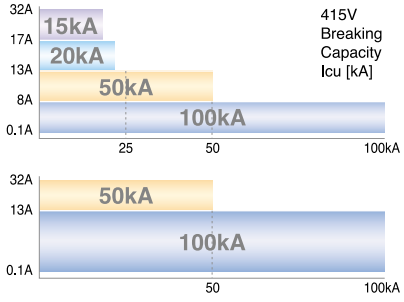

6~10... 47~65A (10 step)

MMS-63S

- Standard

MMS-63H
MMS-63HI

- High break
- Magnetic release

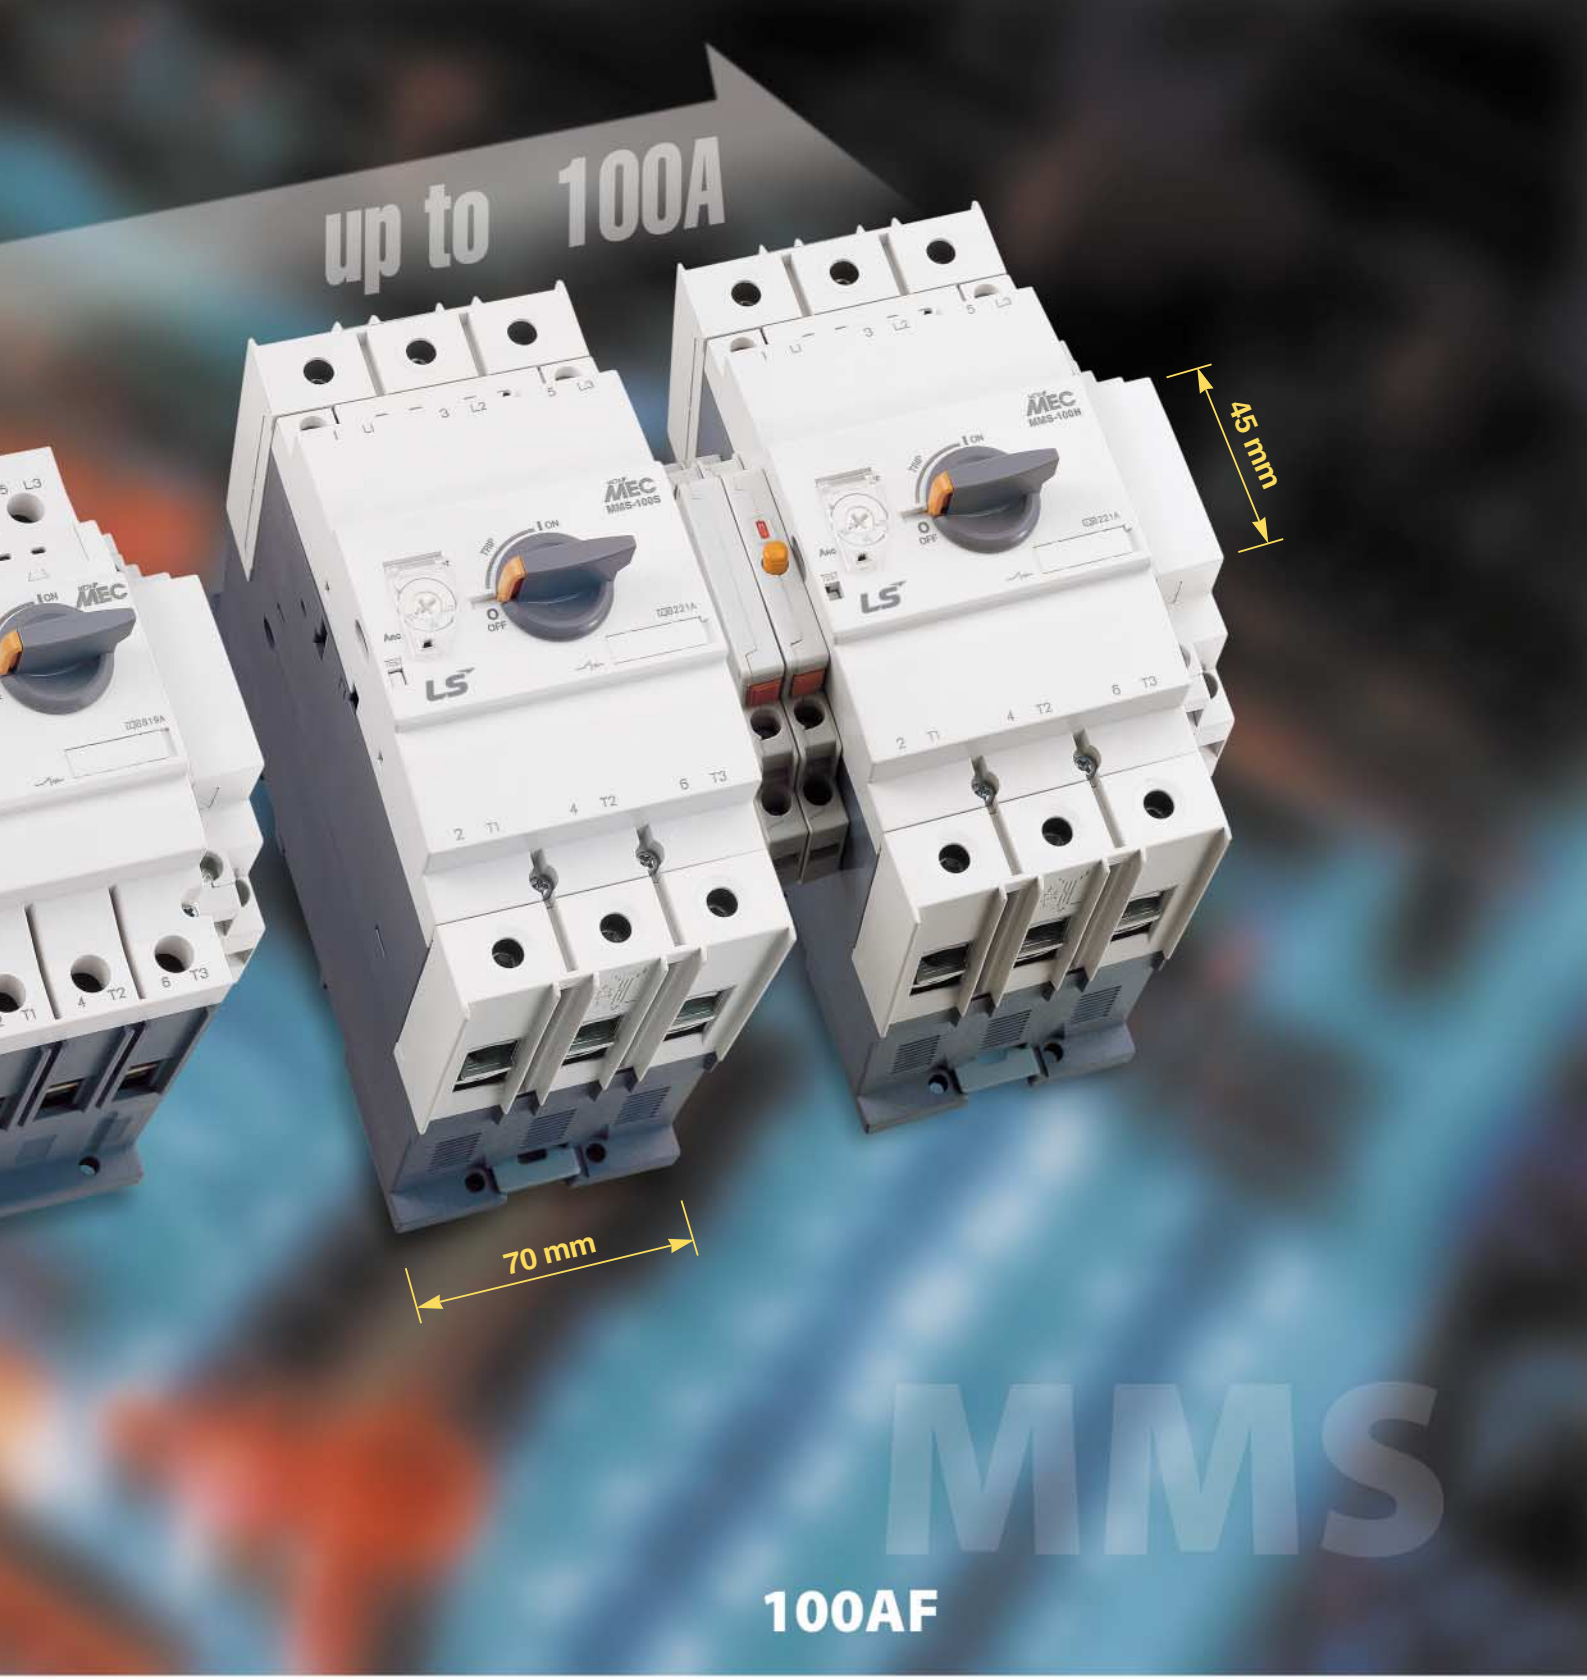

63AF

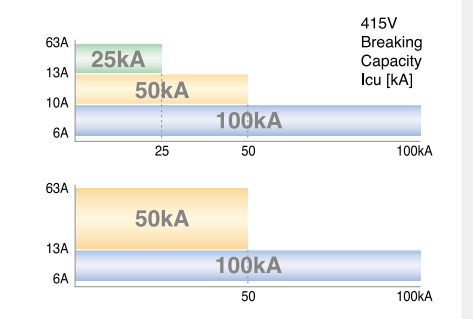

100AF

11~17... 80~100A (10 step)

MMS-100S

- Standard

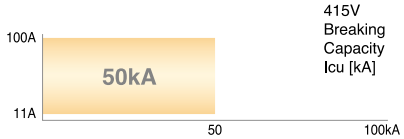

MMS-100H
MMS-100HI

- High break
- Magnetic release

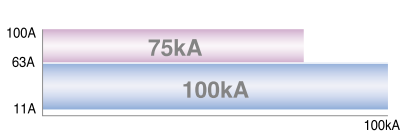

LS Meta-MEC Manual Motor Starters deliver more efficiency through various functions and compact design

MMS 32H... 32A

[Scale 1:1]

Front mounted auxiliary contact

Easy mounting onto DIN-rails

Large scale for current setting

Auxiliaries are just snapped on: easy, fast, without tools

Dial cover lock device

Test trip device for checks of the trip mechanism

Finger safe terminals

Dial cover

Handle Lock device(Off position)

Three position operator handle: ON-OFF-TRIP (Only 100AF is applied)

Identification labels

Handle Lock

Dial cover

Terminals

MMS-32

Screw

MMS-63

Lug

MMS-100

Lug

Common use from 32 to 100AF

A wide variety of accessories enables a flexible response to changes in specifications

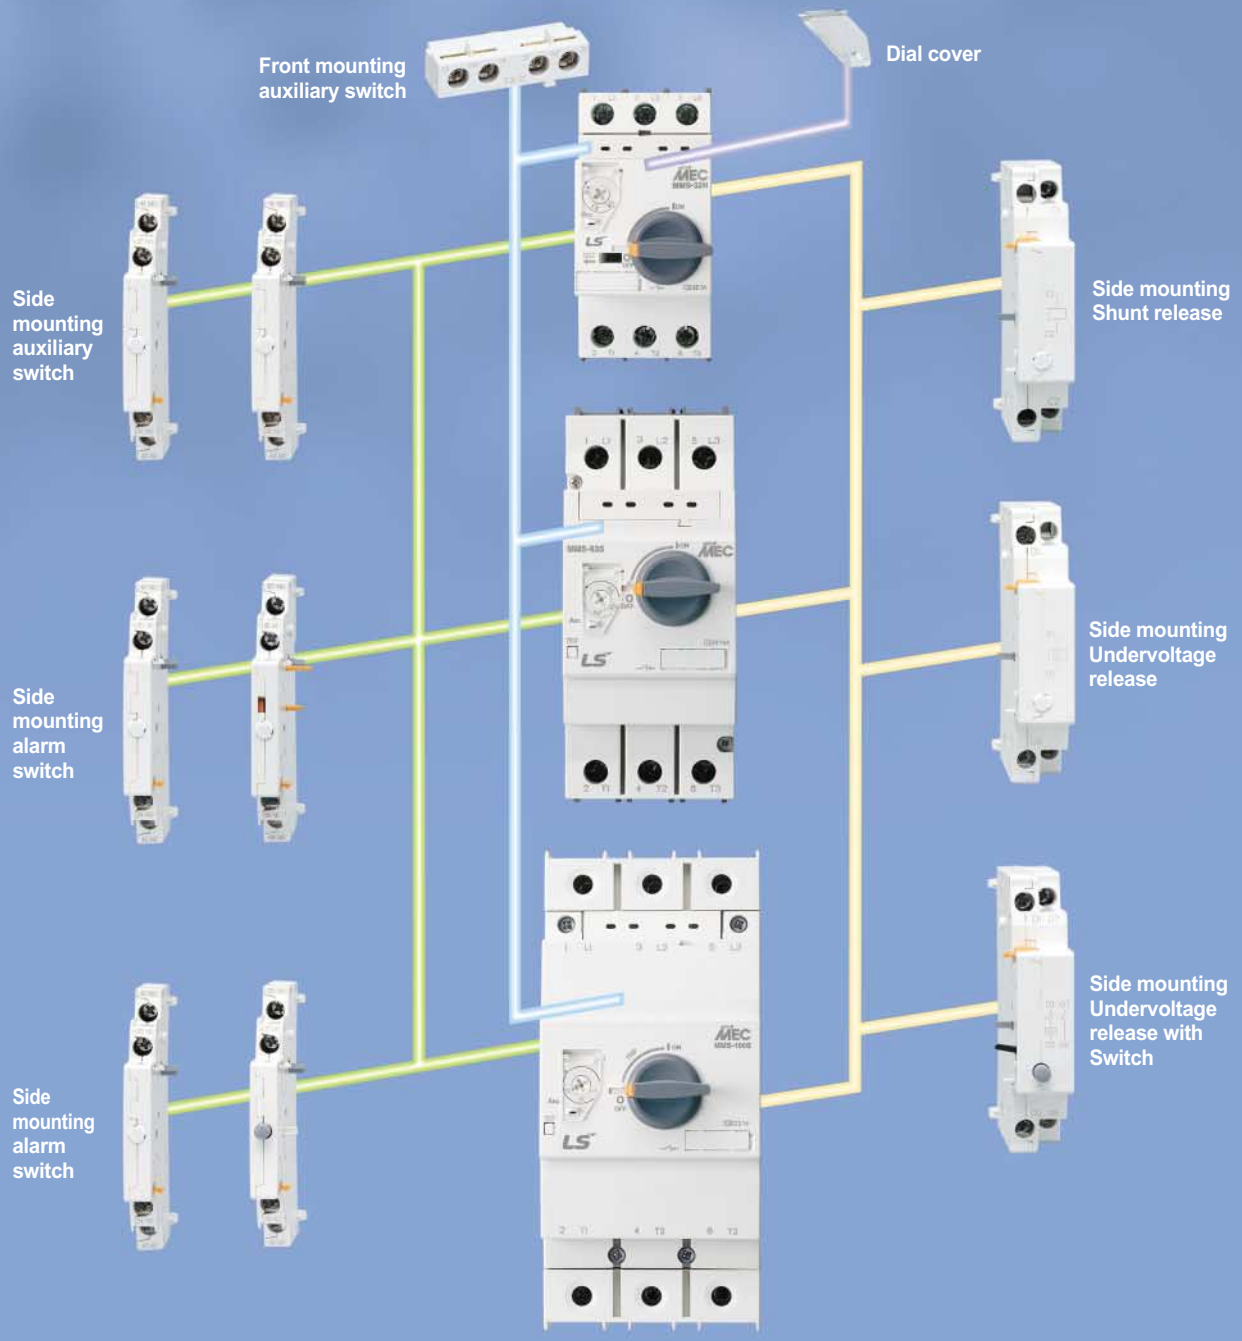
Front mounting auxiliary switch
Dial cover
Side mounting auxiliary switch
Side mounting Shunt release
Side mounting alarm switch
Side mounting Undervoltage release
Side mounting alarm switch
Side mounting Undervoltage release with Switch

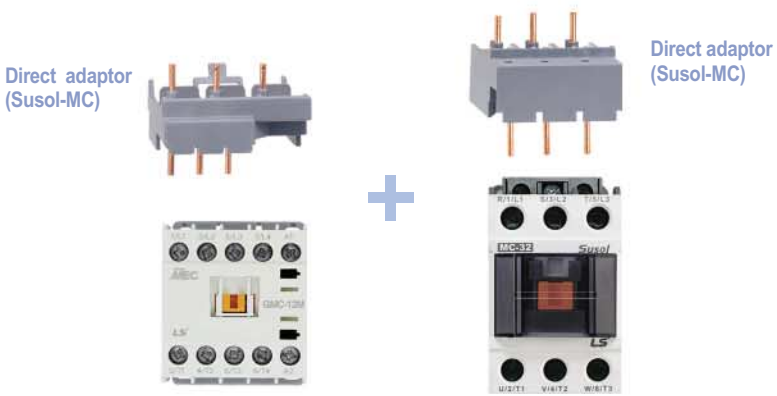

Mini-MC (9~16A)

Susol-MC (9~100A)

Function

- Protection of group installation
- Protection of circuits
- Motor protection
- Starter protection
- Wide range of ambient temperature compensation
- Phase failure protection

Feature

- 45mm width up to 32A, 55mm width up to 63A and 70mm width rated to 100amps
- Three position operator : ON-OFF-TRIP (Only 100AF is applied)
- Complete range of common accessories
- Handle lock in the OFF position
- Class 10 overload trip characteristics
- Trip test
- Finger safe terminal
- Din rail & Screw mounting

Standard

- Comply with the specifications in accordance with
  IEC 60947-2 & IEC 60947-4-1
  UL508 (Manual motor controller)
  UL508 (Combination motor controller type E starter)
  CSA C22.2 NO.14
  GB14048

Certification

- KEMA CB type certificate
- EC-Declaration of conformity
- UL listed
- CSA certified
- CCC

IEC 60947, UL 508
UL 508 Type E, K 60947, GB 14048

Contents

Product Selection Guide

Quick selection table ... IEC rating **8**

Standard type **10**

High breaking type **11**

Instantaneous type **12**

Accessories **13**

Technical Information

General data **18**

IEC performance data (Motor protection) **28**

Manual motor controller
(UL 508, CSA C22.2 as Manual motor controllers) **31**

Manual Motor Controller (UL508) **33**

Type '2' coordination according to IEC 947-4-1 ..... **35**

Time/Current characteristic **36**

Thermal limit on short circuit for MMS **37**

Dimensions **39**

Quick selection table ... IEC rating

Frame			32AF																			
Type	Current adjustable type		MMS-32S										MMS-32H									
	Instantaneous type		-										MMS-32HI									
	Breaking capacity		Standard										High breaking									
	Handle Type		Toggle										Rotary									
Number of poles			3										3									
Rated operational voltage (Ue)			Up to 690V										Up to 690V									
Rated frequency			50/60 Hz										50/60 Hz									
Rated insulation voltage (Ui)			690V										690V									
Rated impulse voltage (Uimp)			6kV										6kV									
Utilization category	IEC 60 947-2 (Breaker)		Cat. A										Cat. A									
	IEC 60 947-4 (Motor starter)		AC 3										AC 3									
Mechanical endurance (Operating)			100,000										100,000									
Electrical endurance (Cycles)			100,000										100,000									
Max operating frequency per hour (Ope./h)			25										25									
Temperature compensation (Operation)			-20 ~ +60℃										-20 ~ +60℃									
Instantaneous short circuit release			13 × Ie max.										13 × Ie max.									
Overload protection			○										○									
Phase failure function			○										○									
Trip indicating function			×										×									
Test function			○										○									
Weight (g)			320										360									
Rated breaking capacity (kA)	Rated operational current (Ie)	Thermal release Adjustment range (A)	220V 240V 230V		415V 400V		460V 440V		525V 500V		690V 600V		220V 240V 230V		415V 400V		460V 440V		525V 500V		690V 600V	
			Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics
	0.16	0.1~0.16	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100
	0.25	0.16~0.25	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100
	0.4	0.25~0.4	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100
	0.63	0.4~0.63	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100
	1	0.63~1	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100
	1.6	1~1.6	100	100	100	100	100	100	100	100	3	3	100	100	100	100	100	100	100	100	100	100
	2.5	1.6~2.5	100	100	100	100	100	100	50	38	3	3	100	100	100	100	100	100	100	100	8	8
	4	2.5~4	100	100	100	100	50	38	15	11	3	3	100	100	100	100	100	100	100	100	8	8
	6	4~6	100	100	100	100	15	11	10	8	3	3	100	100	100	100	100	100	100	100	6	6
	8	5~8	100	100	100	100	15	11	10	8	3	3	100	100	100	100	50	38	50	38	6	6
	10	6~10	100	100	50	38	15	11	6	5	3	3	100	100	100	100	50	38	50	38	6	6
	13	9~13	100	100	50	38	10	8	6	5	3	3	100	100	100	100	50	38	42	32	6	6
	17	11~17	50	38	20	15	10	8	6	5	3	3	100	100	50	38	20	15	10	8	4	4
	22	14~22	40	30	15	11	8	6	6	5	3	3	100	100	50	38	20	15	10	8	4	4
	26	18~26	40	30	15	11	8	6	5	4	3	3	100	100	50	38	20	15	10	8	4	4
	32	22~32	30	22	15	11	6	4	5	4	3	3	100	100	50	38	20	15	10	8	4	4
	40	28~40	20	15	10	8	5	3	4	3	2	2	100	100	40	30	15	11	8	6	3	3
	50	34~50	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
	63	45~63	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
	65	47~65	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
	75	55~75	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
	90	70~90	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
	100	80~100	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-

63AF																				100AF																			
MMS-63S										MMS-63H										MMS-100S										MMS-100H									
-										MMS-63HI										-										MMS-100HI									
Standard										High breaking										Standard										High breaking									
Rotary										Rotary										Rotary										Rotary									
3										3										3										3									
Up to 690V										Up to 690V										Up to 690V										Up to 690V									
50/60 Hz										50/60 Hz										50/60 Hz										50/60 Hz									
1,000V										1,000V										1,000V										1,000V									
8kV										8kV										8kV										8kV									
Cat. A										Cat. A										Cat. A										Cat. A									
AC 3										AC 3										AC 3										AC 3									
50,000										50,000										50,000										50,000									
25,000										25,000										25,000										25,000									
25										25										25										25									
-20 ~ +60℃										-20 ~ +60℃										-20 ~ +60℃										-20 ~ +60℃									
13 × Ie max.										13 × Ie max.										13 × Ie max.										13 × Ie max.									
○										○										○										○									
○										○										○										○									
×										×										○										○									
○										○										○										○									
1,000										1,000										2,200										2,200									
220V 240V 230V		415V 400V		460V 440V		525V 500V		690V 600V		220V 240V 230V		415V 400V		460V 440V		525V 500V		690V 600V		220V 240V 230V		415V 400V		460V 440V		525V 500V		690V 600V		220V 240V 230V		415V 400V		460V 440V		525V 500V		690V 600V	
Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics	Icu	Ics
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
100	100	100	100	15	12	10	8	4	3	100	100	100	100	50	38	50	38	6	5	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
100	100	50	38	10	8	6	5	4	3	100	100	100	100	50	38	42	32	6	5	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
100	100	25	19	10	8	6	5	4	3	100	100	50	50	50	38	12	9	5	5	100	100	50	38	40	30	25	19	10	8	100	100	100	100	50	38	35	27	12	9
50	38	25	19	10	8	6	5	4	3	100	100	50	50	50	38	12	9	5	5	100	100	50	38	40	30	25	19	10	8	100	100	100	50	50	38	35	27	12	9
50	38	25	19	10	8	6	5	4	3	100	100	50	50	35	27	12	9	5	5	100	100	50	38	40	30	25	19	10	8	100	100	100	50	50	38	35	27	12	9
50	38	25	19	10	8	6	5	4	3	100	100	50	50	35	27	10	8	5	5	100	100	50	38	40	30	15	11	10	8	100	100	100	50	50	38	25	19	12	9
50	38	25	19	10	8	6	5	4	3	100	100	50	50	35	27	10	8	5	5	100	100	50	38	40	30	15	11	6	5	100	100	100	50	50	38	20	15	12	9
50	38	25	19	10	8	6	5	4	3	100	100	50	50	35	27	10	8	5	5	100	100	50	38	40	30	12	9	6	5	100	100	100	50	50	38	15	11	10	8
50	38	25	19	10	8	6	5	4	3	100	100	50	50	35	27	10	8	5	5	100	100	50	38	40	30	12	9	6	5	100	100	100	50	50	38	15	11	8	6
50	38	25	19	10	8	6	5	4	3	75	50	35	27	25	19	6	5	3	3	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	100	100	50	38	40	30	8	6	5	4	100	100	75	50	50	38	12	9	6	6
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	100	100	50	38	40	30	8	6	5	4	100	100	75	50	50	38	12	9	6	6
-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	100	100	50	38	40	30	8	6	5	4	100	100	75	50	50	38	12	9	6	6

Standard type

- Adjustable thermal release
- Magnetic release 13 Ie max.
- Trip class 10
- Protective function
- Phase-failure protection
  - phase-failure
  - short circuit
  - overload

MMS-32S

MMS-63S

MMS-100S

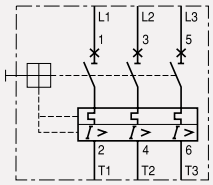

(Circuit diagram)

Type	Rated operational current Ie [A]	Thermal release Adjustment range [A]	Magnetic release Operating current [A]	Switching of 3 phase AC motors, AC-2, AC-3						400/415V	
				3-phase [kW] (50/60Hz)			3-phase [HP] (60Hz)				
				230V	400V	690V	230V	460V	575V	Icu [kA]	Ics [kA]
MMS-32S	0.16	0.1...0.16	2.1	-	0.02	-	-	-	-	100	100
	0.25	0.16...0.25	3.3	0.03	0.06	-	-	-	-	100	100
	0.4	0.25...0.4	5.2	0.06	0.09	-	-	-	-	100	100
	0.63	0.4...0.63	8.2	0.09	0.12	0.25	-	-	-	100	100
	1	0.63...1.0	13	0.12	0.25	0.55	-	1/2	1/2	100	100
	1.6	1.0...1.6	20.8	0.25	0.55	1.1	1/3	3/4	1	100	100
	2.5	1.6...2.5	32.5	0.37	0.75	1.5	1/2	1½	1½	100	100
	4	2.5...4.0	52	0.75	1.5	3	1	2	3	100	100
	6	4...6	78	1.5	2.2	4	1½	5	5	100	100
	8	5...8	104	1.5	3	5.5	2	5	5	100	100
	10	6...10	130	3	4	7.5	3	7½	10	50	38
	13	9...13	169	3	5.5	11	3	7½	10	50	38
	17	11...17	221	4	7.5	11	5	10	15	20	15
	22	14...22	286	4	7.5	15	7½	15	20	15	11
	26	18...26	338	5.5	11	18.5	7½	15	20	15	11
	32	22...32	416	7.5	15	22	10	20	30	15	11
	40	28~40	520	7.5	18.5	30	15	30	40	10	8
MMS-63S	10	6~10	130	3	4	7.5	3	7½	10	100	100
	13	9~13	169	3	5.5	11	3	7½	10	50	38
	17	11~17	221	4	7.5	11	5	10	15	25	19
	22	14~22	286	4	7.5	15	7½	15	20	25	19
	26	18~26	338	5.5	11	18.5	10	20	25	25	19
	32	22~32	416	7.5	15	22	10	25	30	25	19
	40	28~40	520	7.5	18.5	30	15	30	40	25	19
	50	34~50	650	11	22	45	15	40	50	25	19
	63	45~63	819	15	30	55	20	50	60	25	19
	65	47~65	845	15	30	55	20	50	60	25	19
MMS-100S	17	11~17	221	4	7.5	11	5	10	15	50	38
	22	14~22	286	4	7.5	15	7½	15	20	50	38
	26	18~26	338	5.5	11	18.5	10	20	25	50	38
	32	22~32	416	7.5	15	22	10	25	30	50	38
	40	28~40	520	7.5	18.5	30	15	30	40	50	38
	50	34~50	650	11	22	45	15	40	50	50	38
	63	45~63	819	15	30	55	20	50	60	50	38
	75	55~75	975	22	37	63	25	60	75	50	38
	90	70~90	1170	30	45	75	30	75	100	50	38
	100	80~100	1300	30	45	90	40	75	100	50	38

High breaking type

- Adjustable thermal release
- Magnetic release 13 Ie max.
- Trip class 10
- Protective function
- Phase-failure protection
  - phase-failure
  - short circuit
  - overload

MMS-32H

MMS-63H

MMS-100H

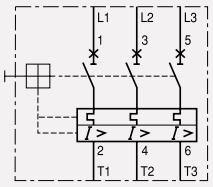

(Circuit diagram)

Type	Rated operational current Ie [A]	Thermal release Adjustment range [A]	Magnetic release Operating current [A]	Switching of 3 phase AC motors, AC-2, AC-3						400/415V	
				3-phase [kW] (50/60Hz)			3-phase [HP] (60Hz)				
				230V	400V	690V	230V	460V	575V	Icu [kA]	Ics [kA]
MMS-32H	0.16	0.1...0.16	2.1	-	0.02	-	-	-	-	100	100
	0.25	0.16...0.25	3.3	0.03	0.06	-	-	-	-	100	100
	0.4	0.25...0.4	5.2	0.06	0.09	-	-	-	-	100	100
	0.63	0.4...0.63	8.2	0.09	0.12	0.25	-	-	-	100	100
	1	0.63...1.0	13	0.12	0.25	0.55	-	1/2	1/2	100	100
	1.6	1.0...1.6	20.8	0.25	0.55	1.1	1/3	3/4	1	100	100
	2.5	1.6...2.5	32.5	0.37	0.75	1.5	1/2	1½	1½	100	100
	4	2.5...4.0	52	0.75	1.5	3	1	2	3	100	100
	6	4...6	78	1.5	2.2	4	1½	5	5	100	100
	8	5...8	104	1.5	3	5.5	2	5	5	100	100
	10	6...10	130	3	4	7.5	3	7½	10	100	100
	13	9...13	169	3	5.5	11	3	7½	10	100	100
	17	11...17	221	4	7.5	11	5	10	15	50	38
	22	14...22	286	4	7.5	15	7½	15	20	50	38
	26	18...26	338	5.5	11	18.5	7½	15	20	50	38
	32	22...32	416	7.5	15	22	10	20	30	50	38
	40	28~40	520	7.5	18.5	30	15	30	40	40	30
MMS-63H	10	6~10	130	3	4	7.5	3	7½	10	100	100
	13	9~13	169	3	5.5	11	3	7½	10	100	100
	17	11~17	221	4	7.5	11	5	10	15	50	50
	22	14~22	286	4	7.5	15	7½	15	20	50	50
	26	18~26	338	5.5	11	18.5	10	20	25	50	50
	32	22~32	416	7.5	15	22	10	25	30	50	50
	40	28~40	520	7.5	18.5	30	15	30	40	50	50
	50	34~50	650	11	22	45	15	40	50	50	50
	63	45~63	819	15	30	55	20	50	60	50	50
	65	47~65	845	15	30	55	20	50	60	35	27
MMS-100H	17	11~17	221	4	7.5	11	5	10	15	100	100
	22	14~22	286	4	7.5	15	7½	15	20	100	50
	26	18~26	338	5.5	11	18.5	10	20	25	100	50
	32	22~32	416	7.5	15	22	10	25	30	100	50
	40	28~40	520	7.5	18.5	30	15	30	40	100	50
	50	34~50	650	11	22	45	15	40	50	100	50
	63	45~63	819	15	30	55	20	50	60	100	50
	75	55~75	975	22	37	63	25	60	75	75	50
	90	70~90	1170	30	45	75	30	75	100	75	50
	100	80~100	1300	30	45	90	40	75	100	75	50

Product Selection Guide

Instantaneous type

- Without thermal releases
- Magnetic release 13 Ie max.
- Protective function
  - short circuit

MMS-32HI

MMS-63HI

MMS-100HI

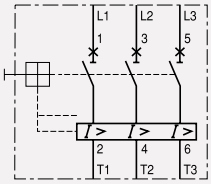

(Circuit diagram)

Type	Rated operational current Ie [A]	Thermal release Adjustment range [A]	Magnetic release Operating current [A]	Switching of 3 phase AC motors, AC-2, AC-3						400/415V	
				3-phase [kW] (50/60Hz)			3-phase [HP] (60Hz)				
				230V	400V	690V	230V	460V	575V	Icu [kA]	Ics [kA]
MMS-32HI	0.16	-	2.1	-	0.02	-	-	-	-	100	100
	0.25	-	3.3	0.03	0.06	-	-	-	-	100	100
	0.4	-	5.2	0.06	0.09	-	-	-	-	100	100
	0.63	-	8.2	0.09	0.12	0.25	-	-	-	100	100
	1	-	13	0.12	0.25	0.55	-	1/2	1/2	100	100
	1.6	-	20.8	0.25	0.55	1.1	1/3	3/4	1	100	100
	2.5	-	32.5	0.37	0.75	1.5	1/2	1½	1½	100	100
	4	-	52	0.75	1.5	3	1	2	3	100	100
	6	-	78	1.5	2.2	4	1½	5	5	100	100
	8	-	104	1.5	3	5.5	2	5	5	100	100
	10	-	130	3	4	7.5	3	7½	10	100	100
	13	-	169	3	5.5	11	3	7½	10	100	100
	17	-	221	4	7.5	11	5	10	15	50	38
	22	-	286	4	7.5	15	7½	15	20	50	38
	26	-	338	5.5	11	18.5	7½	15	20	50	38
	32	-	416	7.5	15	22	10	20	30	50	38
	40	28~40	520	7.5	18.5	30	15	30	40	40	30
MMS-63HI	10	-	130	3	4	7.5	3	7½	10	100	100
	13	-	169	3	5.5	11	3	7½	10	100	100
	17	-	221	4	7.5	11	5	10	15	50	50
	22	-	286	4	7.5	15	7½	15	20	50	50
	26	-	338	5.5	11	18.5	10	20	25	50	50
	32	-	416	7.5	15	22	10	25	30	50	50
	40	-	520	7.5	18.5	30	15	30	40	50	50
	50	-	650	11	22	45	15	40	50	50	50
	63	-	819	15	30	55	20	50	60	50	50
	65	47~65	845	15	30	55	20	50	60	35	27
MMS-100HI	17	-	221	4	7.5	11	5	10	15	100	100
	22	-	286	4	7.5	15	7½	15	20	100	50
	26	-	338	5.5	11	18.5	10	20	25	100	50
	32	-	416	7.5	15	22	10	25	30	100	50
	40	-	520	7.5	18.5	30	15	30	40	100	50
	50	-	650	11	22	45	15	40	50	100	50
	63	-	819	15	30	55	20	50	60	100	50
	75	-	975	22	37	63	25	60	75	75	50
	90	-	1170	30	45	75	30	75	100	75	50
	100	-	1300	30	45	90	40	75	100	75	50

Accessories (Electrical Auxiliaries)

Type	Description	Connection diagram
FX...	**Auxiliary Switch** · Front mounting · 2-pole · One front mounting module per circuit breaker	1NO1NC 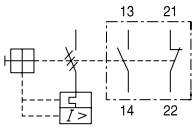 2NO 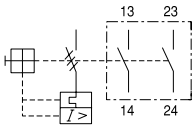 2NC 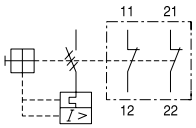
LX...	**Auxiliary Switch** · Side mounting on the left · 2-pole · One side mounting module per circuit breaker	1NO1NC 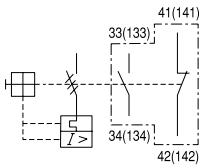 2NO 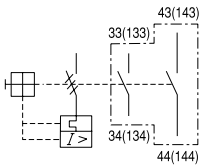 2NC 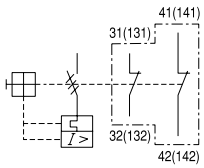
LA...	**Any Trip Alarm Switch** · Operates in case of trip · Side mounting on the left · 2-pole · Set LA first in case of using LX together (MMS-63 can not accept LX and LA together)	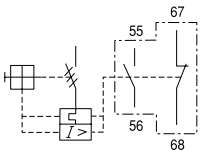 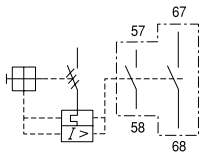 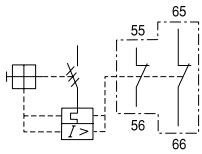
LAM...	**Magnetic Trip Alarm Switch** · Operates in case of instantaneous trip · Side mounting on the left · 2-pole · Set LAM first in case of using LX together	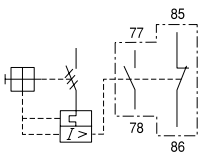 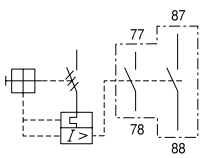 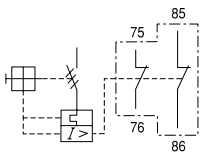

Accessories (Electrical Auxiliaries)

Type	Description	Connection diagram	
RS...	**Shunt release** · Side mounting on the right · One side mounting module per circuit breaker. · Can not use with RU or RUX	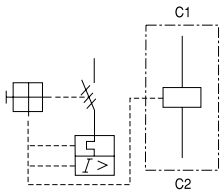	24V 50Hz / 28V 60Hz 110V 50Hz / 120V 60Hz 200V 50Hz / 200~220V 60Hz 220~230V 50Hz / 240~260V 60Hz 240V 50Hz / 277V 60Hz 380~400V 50Hz / 440~460V 60Hz 415~440V 50Hz / 460~480V 60Hz
RU...	**Undervoltage release** · Side mounting on the right · One side mounting module per circuit breaker. · Can not use with RU or RUX	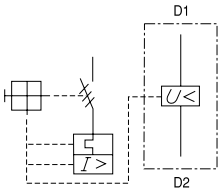	24V 50Hz / 28V 60Hz 110V 50Hz / 120V 60Hz 200V 50Hz / 200~220V 60Hz 220~230V 50Hz / 240~260V 60Hz 240V 50Hz / 277V 60Hz 380~400V 50Hz / 440~460V 60Hz 415~440V 50Hz / 460~480V 60Hz
RUX...	**Undervoltage release with Switch** · Side mounting on the right · Include 2NO Auxiliary contact · One side mounting module per circuit breaker. · Can not use with RU or RUX · Can not attach to MMS-32S	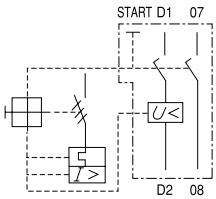	24V 50Hz / 28V 60Hz 110V 50Hz / 120V 60Hz 200V 50Hz / 200~220V 60Hz 220~230V 50Hz / 240~260V 60Hz 240V 50Hz / 277V 60Hz 380~400V 50Hz / 440~460V 60Hz 415~440V 50Hz / 460~480V 60Hz

● E-Handle (Rotary-type)

MMS E-Handle is a Rotary-type Handle accessory which can be attached to the front to control and verify the ON, TRIP, OFF condition of Manual
Motor Starters under the situation of closing panel.

- Application Model : MMS-32H/HI,MMS-63S/H/HI, MMS-100S/H/HI
- Operation temp. : -20~ +60°C
- CE and UL certified
- Degree of protection : IP65
- Locking device : Lockable in on/off position
- Material of insulation : Plastic(PA66)

Type	Application MMS	Remarks
MEH-32	MMS-32H, 32HI	Length of shaft : 115 or 315mm
MEH-63	MMS-63S, 63H, 63HI	
MEH-100	MMS-100S, 100H, 100HI	

● Phase Bus

It is a device for a parallel connection with power terminals in the circuit lined up by MMS, and it can provides the solution "Simple wiring" and "Compact wiring space".

- Application Model : MMS-32, 63
- CE and UL certified
- Safety Cover built-in
- RoHS compliance

Type	Application MMS	Number of Terminals	Rated current	Safety cover attached
PB-322	MMS-32S, 32H, 32HI	2	63A	PBPC-32 (32for S, H)
PB-323		3		
PB-632	MMS-63S, 63H, 63HI	2	108A	PBPC-63
PB-633		3		

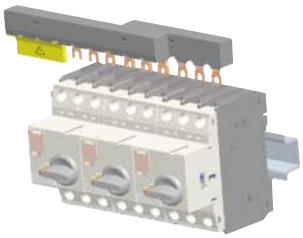

● Diagram

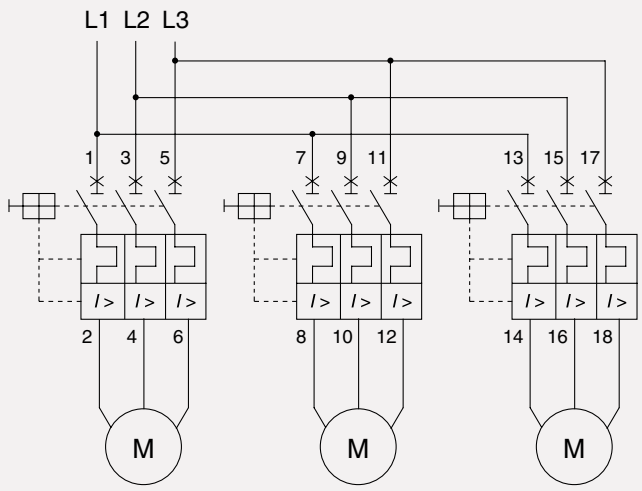

Accessories (Electrical Auxiliaries)

● Enclosure

Case cover of MMS enclosure is specifically designed with dust-proof and corrosive-proof structure.
Therefore, it is the optimum product to use in dusty areas such as cement plants, cotton mills as well as in the presence of corrosive gas or liquid (excl. explosive, flammable gas) such as fertilizer, refinery, and plating plant.

- Application Model: MMS-32H/HI
- Operation temp. : -20~ +60℃
- CE and UL certified
- Degree of protection : IP65
- Material of insulation :Plastic(ABS)

Type	Application MMS	Remarks
EPH-32	MMS-32H, 32HI	Surface mount

● Dial Cover

Dial cover is used to protect the set value from the operation that is not intended.
It is supplied as standard for all MMS.

- Application Model : MMS-32, 63,100 (All types)

● Insulation Barrier

Insulation barrier is used to enlarge the creepage distance and clearance to meet the requirement of UL.

- Application Model : MMS-100

Type	Application MMS
IB100	MMS-100S, 100H, 100HI

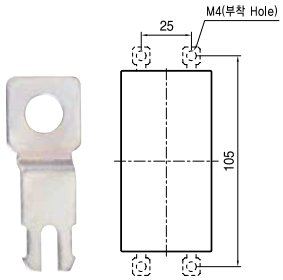

● Screw mounting holder

32AF MMS is only for DIN rail mountable by itself. Screw mounting holder is used to mount MMS on a panel by screws.

- Application Model : MMS-32

Type	Application MMS	Remarks
MP-32	MMS-32S, 32H, 32HI	For M4 screw

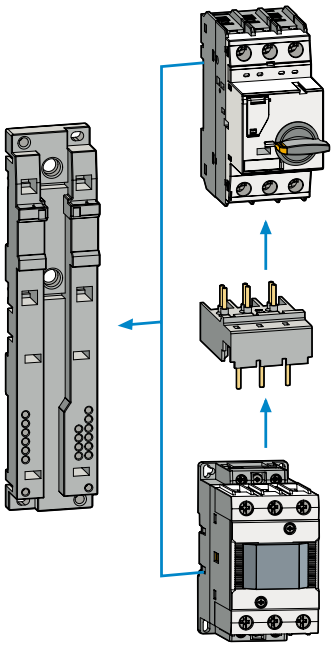

● Direct adaptor and Mounting unit

Direct adaptor , DA

Direct adaptor is used to connect MMS directly with a contactor

Mounting unit , MU

This device is attached module to connect joined MMS with a contactor

· Application Model : MMS+ Susol contactor(MC-9~95), Mini contactor

Type		Combined devices	
Direct adaptor	Mounting unit	MMS	MC
DA-16SA	MU-45	MMS-32S	Mini-MC GMC-6M~16M (AC control)
DA-16SD			Mini-MC GMC-6M~16M (DC control)
DA-16HA		MMS-32H, 32HI	Mini-MC GMC-6M~16M (AC control)
DA-16HD			Mini-MC GMC-6M~16M (DC control)
DA-18SA		MMS-32S	MC-6a~18a (AC control)
DA-18SD			MC-6a~18a (DC control)
DA-18HA		MMS-32H	MC-6a~18a (AC control)
DA-18HD			MC-6a~18a (DC control)
DA-32SA		MMS-32S	MC-9~32 (AC control)
DA-32SD			MC-9~32 (DC control)
DA-32HA		MMS-32H, 32HI	MC-9~32 (AC control)
DA-32HD			MC-9~32 (DC control)
DA-63A	MU-55	MMS-63S, 63H, 63HI	MC-35~63 (AC control)
DA-63D			MC-35~63 (DC control)
DA-95A	MU-70	MMS-100S, 100H, 100HI	MC-65~95 (AC control)
DA-95D			MC-65~95 (DC control)

Note) MMS and Contactor connected with Direct adaptor.

General data

● Terminals

			MMS32S	MMS32H	MMS63S, 63H	MMS100S, 100H
Conformity to standards			IEC60947 UL508, UL508 Type E			
Approvals			CE, UL			
Terminal parts						
Screwdriver						
Single-core	1.conductor	[㎟] / [AWG]	1...10 / 18...8	1...10 / 18...8	0.75...35 / 18...2	2.5...70 / 12...2/0
	2.conductor	[㎟] / [AWG]	1...6 / 18...10	1...6 / 18...10	0.75...25 / 18...4	2.5...50 / 12...1/0
Standard	1.conductor	[㎟] / [AWG]	1...6 / 18...10	1...6 / 18...10	0.75...35 / 18...2	2.5...70 / 12...2/0
	2.conductor	[㎟] / [AWG]	1...6 / 18...10	1...6 / 18...10	0.75...25 / 18...4	2.5...50 / 12...1/0
Flexible	1.conductor	[㎟] / [AWG]	1...6 / 18...10	1...6 / 18...10	0.75...25 / 18...4	2.5...50 / 12...1/0
	2.conductor	[㎟] / [AWG]	0.75...4 / 18...10	0.75...4 / 18...10	0.75...16 / 18...6	2.5...35 / 10...2
Tightening torque		[Nm] / [lb-in]	0.8...2.5 / 7...22	0.8...2.5 / 7...22	3...4.5 / 26...39	4...6 / 35...53

● Power consumption

		MMS32S	MMS32H	MMS63S, 63H	MMS100S, 100H
Total power loss Pv					
Circuit breaker at rated load	[W]	In = 0.16~1.6A : 4.4	In = 0.16~1.6A : 4.4	In = 10~22A : 10.2	In = 17~32A : 15
operating temperature		In = 2.5~26A : 7.4	In = 2.5~26A : 7.4	In = 26~63A : 9.7	In = 40~63A : 21.8
		In = 32A : 4.0	In = 32A : 4.0		In = 75~100A : 17.8

● Mounting

35mm DIN rail for MMS32~63
35mm or 75mm DIN rail for MMS100
- use 15mm depth for 35mm DIN rail

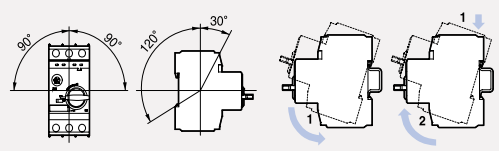

Operating positions DIN rail mounting

● Environment

Ambient air temperature
storage : - 50···+ 80 °C
operation : - 20···+ 60 °C
Ambient temperature compensation : - 20···+ 60 °C
Maximum operating altitude : 2000m
Protection degree : IP20
Shock resistance : 25g
Vibration resistance : 5~150Hz

● Caution for thermal adjustments

1.Keep the setting range as shown below.
2.Moving counterclockwise out of the setting range may cause the damage of the device.

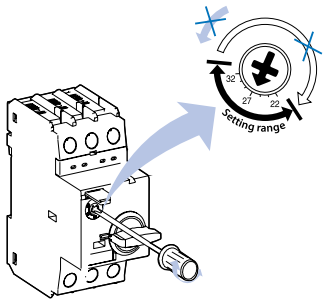

Dial setting method

3. Calibration by ambient air temperature



In case of using out of the standard air temperature range(-5°C~+40°C) it needs to be calibrated by one point

● Auxiliaries

			Auxiliary contacts for front mounting **FX...**		Auxiliary contacts for left side mounting **LX...**		Alarm switch for left side mounting **LA...**	
Rated thermal current / th								
at 40℃ ambient temperature		[A]	5		10		10	
at 60℃ ambient temperature		[A]	3		6		6	
Contact class coordination according to NEMA (UL/CSA-Standards)		AC	A600		A600		A600	
		DC	Q300		Q300		Q300	
Back-up fuses gG, gL		[A]	16		16		16	
Rated supply current		[V]	-	240	24	240	24	240
	AC-15:	[A]	-	3	6	4	6	4
	DC-13:	[V]	24	220	24	220	24	220
		[A]	1	0.1	2	0.25	2	0.25
Weight (g)			18		30		40	
Terminal parts								
Screwdriver					Pozidriv size 2			
Single-core	1.conductor	[㎟] / [AWG]	0.5...2.5 / 20...14		0.5...2.5 / 20...14			
	2.conductor	[㎟] / [AWG]	-		0.5...2.5 / 20...14			
Standard	1.conductor	[㎟] / [AWG]	0.5...4 / 20...10		0.5...4 / 20...10			
	2.conductor	[㎟] / [AWG]	0.75...2.5 / 18...14		0.75...2.5 / 18...14			
Tightening torque		[Nm] / [lb-in]	0.8...1.2 / 7...10		0.8...1.2 / 7...10			

			Undervoltage release for right side mounting **RU...**	Undervoltage release with 2 auxiliary contacts for right side mounting **RUX...**	Shunt release for right side mounting **RS...**
Actuating voltage					
Pull-in			0.7...1.1×Us	0.85...1.1×Us	0.85...1.1×Us
Drop-out				0.7...0.35×Us	0.7...0.35×Us
Rated control voltage					
min.:			24V 50Hz / 28V 60Hz	24V 50Hz / 28V 60Hz	24V 50Hz / 28V 60Hz
max.:			415~440V 50Hz / 460~480V 60Hz	415~440V 50Hz / 460~480V 60Hz	415~440V 50Hz / 460~480V 60Hz
Coil rating					
Pull-in			8.5VA, 6W	8.5VA, 6W	8.5VA, 6W
Hold			3VA, 1.2W	3VA, 1.2W	3VA, 1.2W
Opening time (ms)			-	20	20
Weight (g)			18	30	40
Terminal parts					
Screwdriver				Pozidriv size 2	
Single-core	1.conductor	[㎟] / [AWG]		0.5...2.5 / 20...14	
	2.conductor	[㎟] / [AWG]		0.5...2.5 / 20...14	
Standard	1.conductor	[㎟] / [AWG]		0.5...4 / 20...10	
	2.conductor	[㎟] / [AWG]		0.75...2.5 / 18...14	
Tightening torque		[Nm] / [lb-in]		0.8...1.2 / 7...10	

General data

● Installation of auxiliaries

Be sure to turn off the main switch of MMS before any other action.



MMS-32S/H/HI

- To install FX remove the cover ① first.
- 2 each of LX can be installed together.
- Only one of auxiliaries among RU, RS and RUX can be mounted on the right side of MMS.
- Do not give trip signal to RS longer than 10 sec.
- Refer to the possible combination chart for the mounting of LX, LA and LAM on left side of MMS.

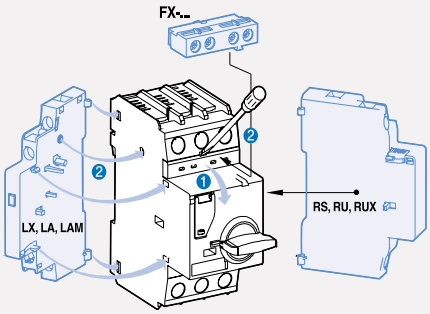

- Push the trip button before installation of LAM

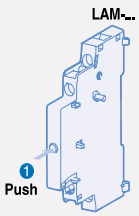

- Remove the indicated part in the fig. before the additional installation of LX

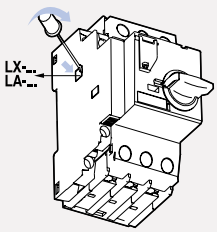

Separation of auxiliaries from MMS

- be sure to turn off the main switch of MMS before the separation.
- push softly the separation button on the side of the auxiliary and pull it.

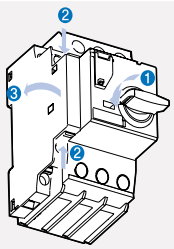

MMS-63, 100S/H/HI

- To install FX remove the cover ① first.
- 2 each of LX can be installed together. (only 1 each for MMS-63)
- Only one of auxiliaries among RU, RS and RUX can be mounted on the right side of MMS.
- Do not give trip signal to RS longer than 10 sec.
- Refer to the possible combination chart for the mounting of LX, LA and LAM on left side of MMS.

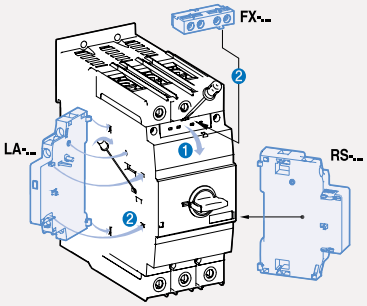

- Push the trip button before installation of LAM

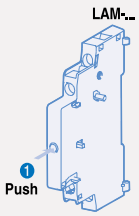

- Remove the indicated part of MMS-63 and MMS-100 asshown in the fig. before the installation of LA

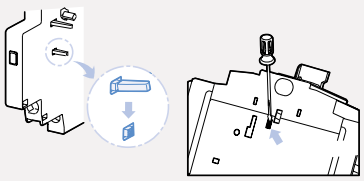

- Do not install LA in the status of TRIP of MMS-100

- Remove the indicated part as shown in the above fig. before the additional installation of LX

Separation of auxiliaries from MMS

- be sure to turn off the main switch of MMS before the separation.
- push softly the separation button on the side of the auxiliary and pull it.

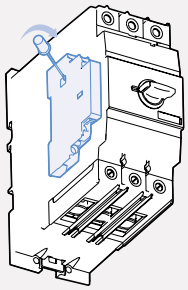

General data

● Installation of auxiliaries

How to Install and reset RUX

Installing
(1) Check if the trip button of RUX is "UP" .
If not, push the side lever ① to come it up.
(2) Fit the both lower hooks ② into the MMS.
(3) Rotate the handle of MMS to the
20 to 30 degree ③ to ON direction and keep it.
(4) Fit the both upper hooks ④into the MMS.
(5) Input power to the RUX.
(6) Turn ON the handle of MMS.

Resetting
The trip button of RUX does not come "UP"
in the event of tripping due to undervoltage.
To turn ON the MMS after the tripping
① turn OFF the MMS and check if the trip button
of RUX comes "UP" .
② push the trip button
③ turn ON the MMS

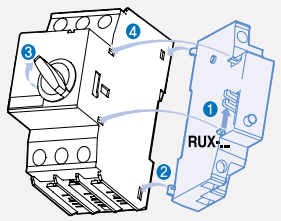

Insulation

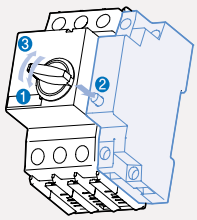

Reset

Insulation barrier

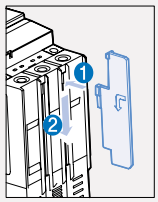

* Only for MMS-100

Dial cover

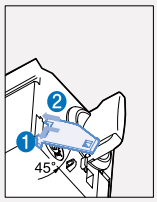

* For all MMS

Combination with mini contactors

Adaptor	MMS	+	Contactor model
DA-16SA	MMS-32S	+	GMC-6M~16M
DA-16SD	MMS-32S	+	GMD-6M~16M
DA-16HA	MMS-32H	+	GMC-6M~16M
DA-16HD	MMS-32H	+	GMD-6M~16M
DA-18SA	MMS-32S	+	MC-6a~18a (AC)
DA-18SD	MMS-32S	+	MC-6a~18a (DC)
DA-18HA	MMS-32H	+	MC-6a~18a (AC)
DA-18HD	MMS-32H	+	MC-6a~18a (DC)
DA-32SA	MMS-32S	+	MC-9~32 (AC)
DA-32HA	MMS-32H	+	MC-9~32 (AC)
DA-63A	MMS-63	+	MC-35~63 (AC)
DA-95A	MMS-100	+	MC-65~95 (AC)
DA-32SD	MMS-32S	+	MC-9~32 (DC)
DA-32HD	MMS-32H	+	MC-9~32 (DC)
DA-63D	MMS-63	+	MC-35~63 (DC)
DA-95D	MMS-100	+	MC-65~95 (DC)

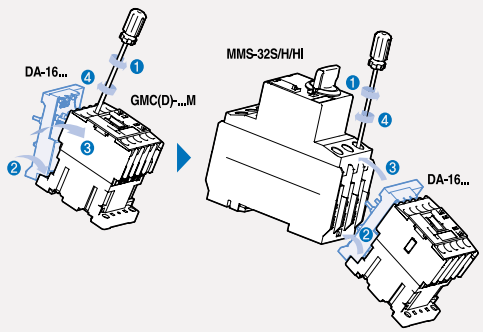

Possible combination chart

Please read this chart completely
before installing the auxiliaries.
Improper combination can cause electric
failure or accident.

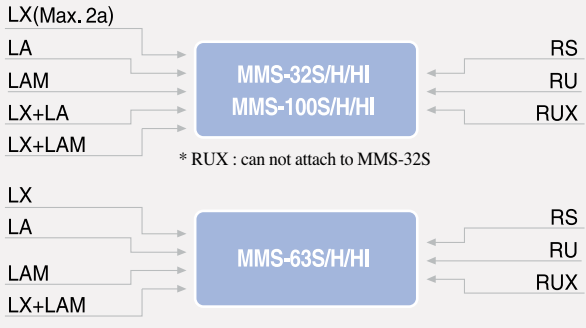

● E-Handle

Structure

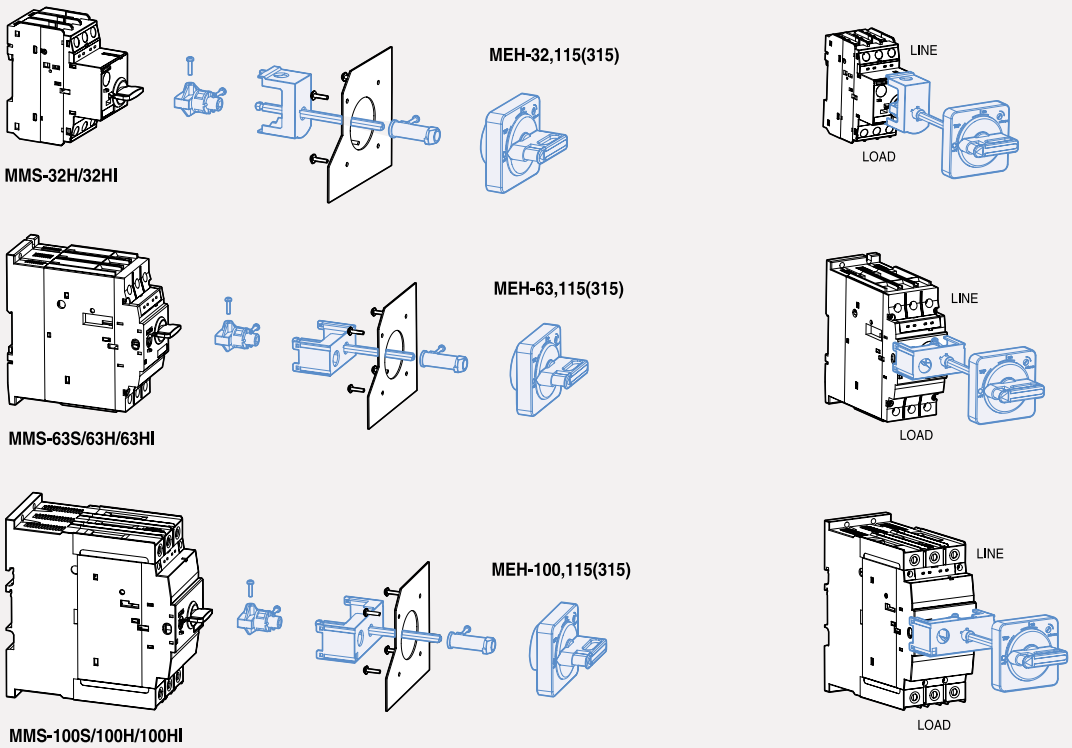

Locking Device

When opening the panel door at ON position

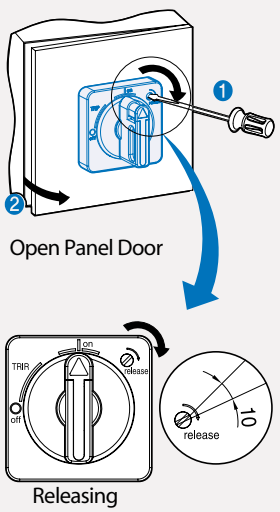

Locking
Installation at OF, OFF position

❶ Setting to regular position through turning the handle

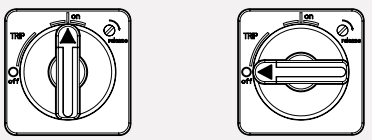

On Position
(Vertical State)

Off Position
(Horizontal State)

❷ Pushing

❸ Locking

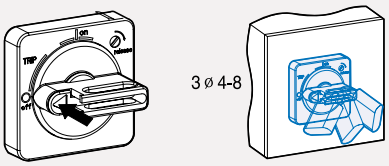

General data

● E-Handle

Installation

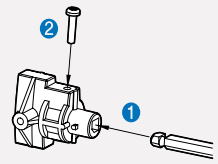

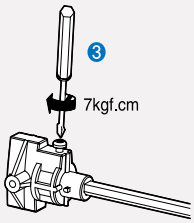

MEH-32/63/100

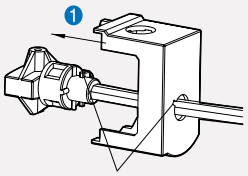

Projection should be passed through the hole when assembling

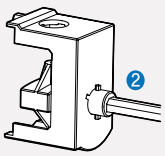

MEH-32

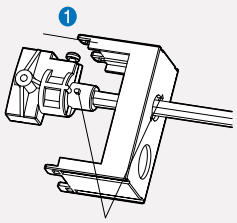

Projection should be passed through the hole when assembling

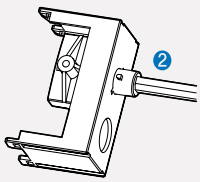

MEH-63/100

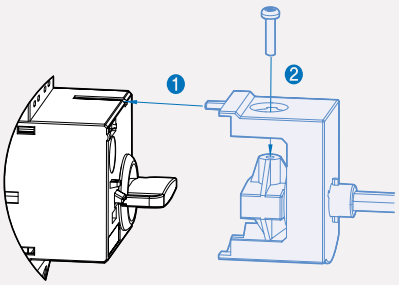

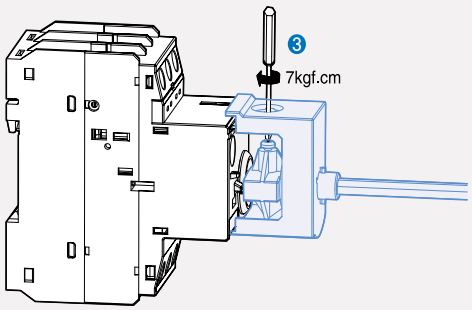

MEH-32

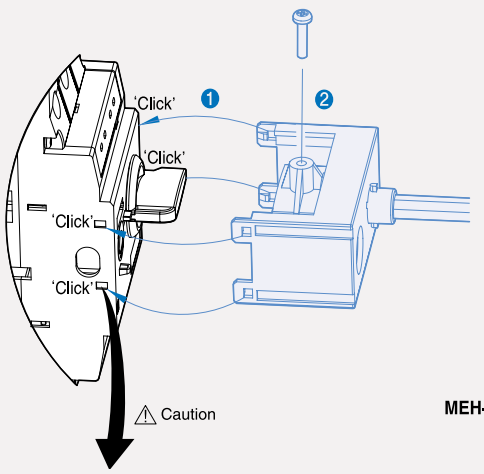

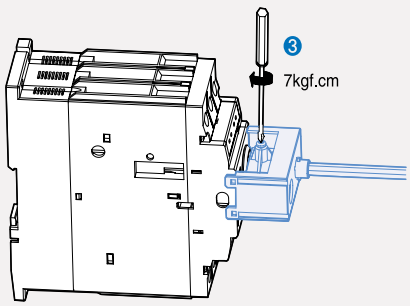

MEH-63/100

Restricted fact of Assembling
Assembling is available for MMS-63/100 with 4 holes on the main cover which is produced after June, 2007 based on manufacturing date.

Operating Test

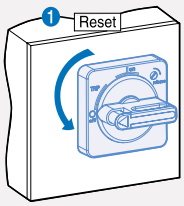

※Caution
If trying to open the door at ON or Trip position, locking knob can be damaged.

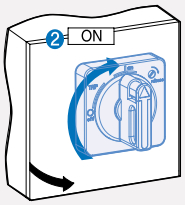

At On position
Panel door can not be opened

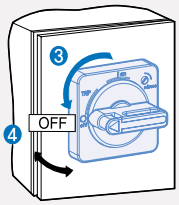

At Trip position
Panel door can not be opened.
At Off position
Panel door can be opened

Cutting off the shaft & applying the handle

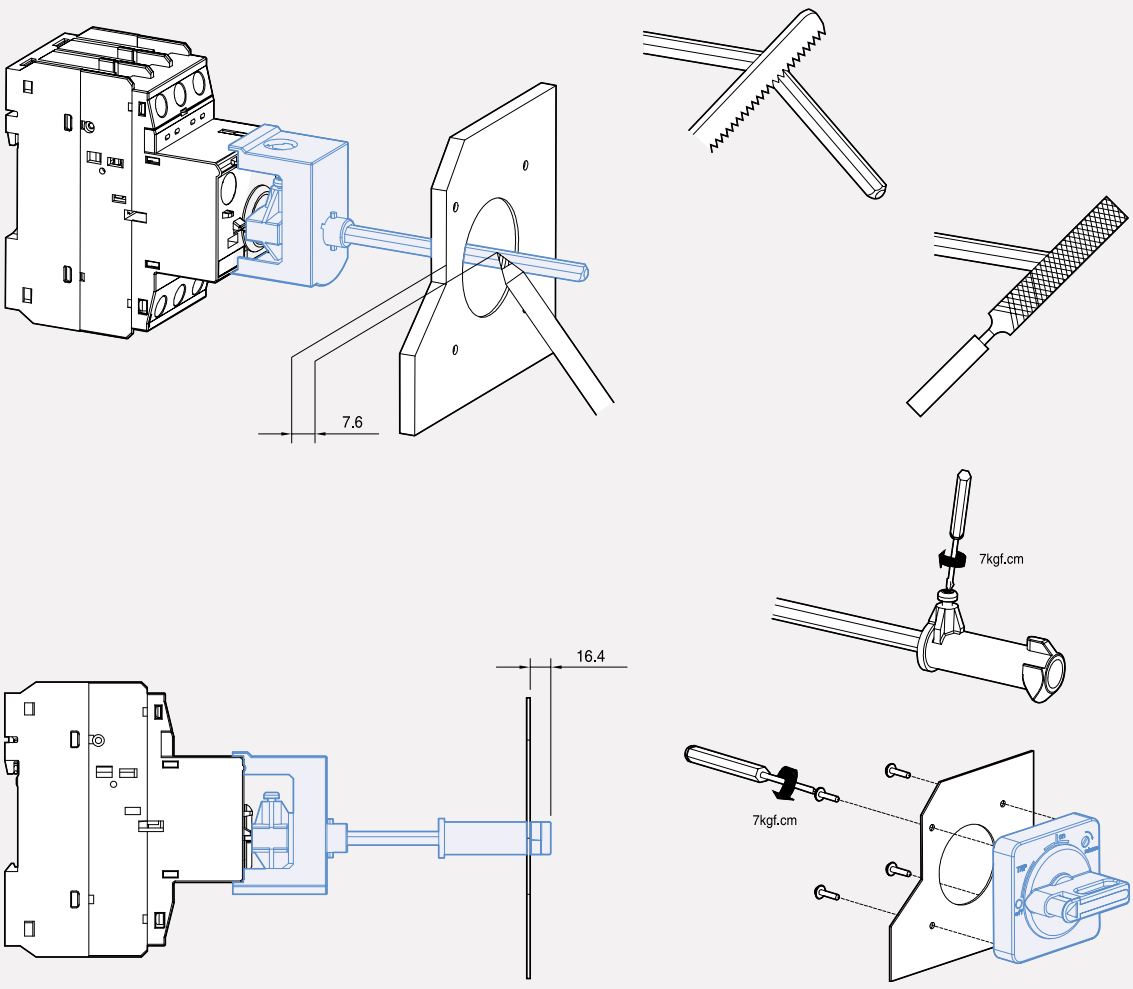

General data

● Enclosure

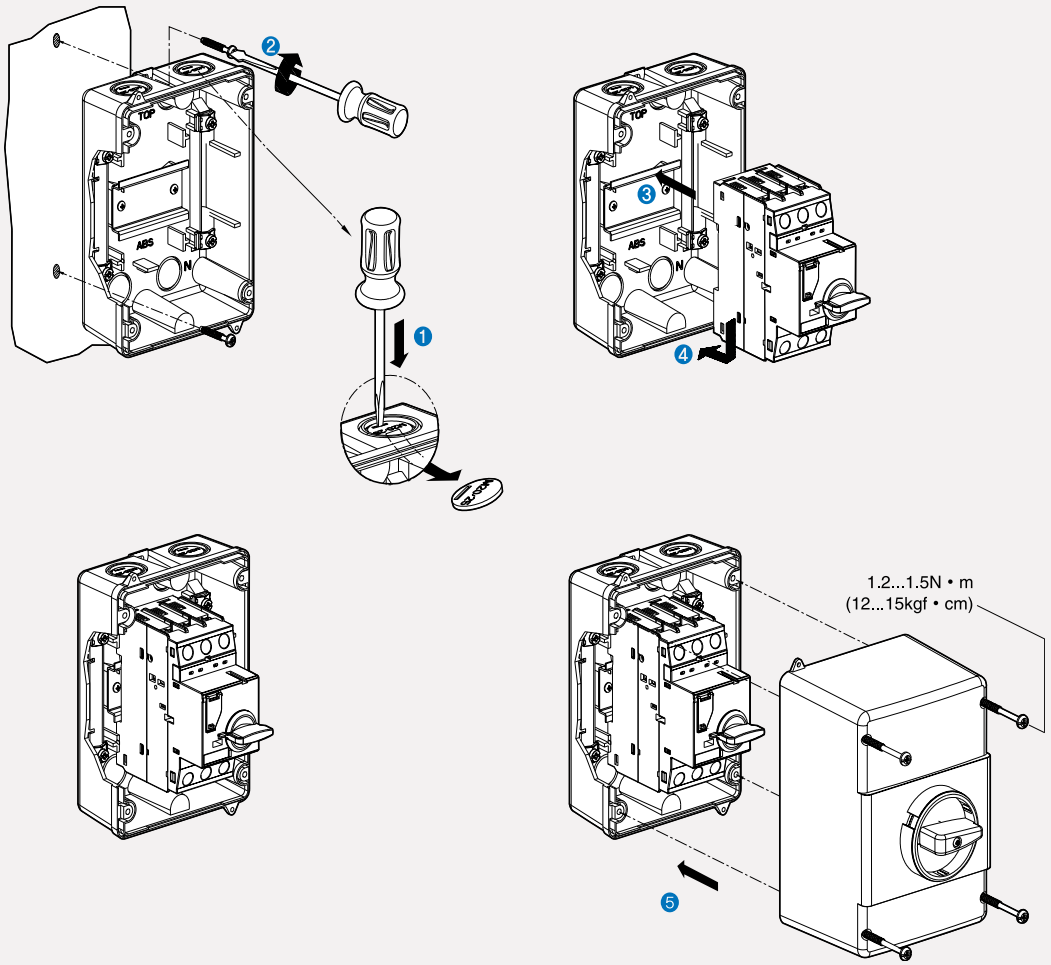

IEC performance data (Motor protection)

Standard type

● MMS 32S

Rated operational current I_e	[A]	0.16	0.25	0.4	0.63	1	1.6	2.5	4	6	8	10	13	17	22	26	32	40
Switching of standard three-phase motors AC-2, AC-3																		
230/240V	[kW]	-	0.03	0.06	0.09	0.12	0.18/0.25	0.37	0.55/0.75	1.1/1.5	1.5	2.2/3	3	3.7/4	4	5.5	7.5	7.5
400/415V	[kW]	0.02	0.06	0.09	0.12	0.18/0.25	0.37/0.55	0.75	1.1/1.5	2.2	3	3.7/4	5.5	7.5	7.5	11	15	18.5
500V	[kW]	-	-	-	0.25	0.37	0.55/0.75	1.1	1.5/2.2	3	3.7	4/5.5	7.5	11	11	15	18.5	22
690V	[kW]	-	-	-	0.25	0.37/0.55	0.75/1.1	1.5	2.2/3	3.7/4	5.5	7.5	11	11	15	18.5	22	30
Back-up fuses gG, gL,, only if Icc>I_{cu} (* = No back up fuse required)																		
230/240V	[A]	*	*	*	*	*	*	*	*	*	*	*	*	*	125	125	125	160
400/415V	[A]	*	*	*	*	*	*	*	*	*	*	80	80	100	100	100	100	125
440/460V	[A]	*	*	*	*	*	*	*	50	50	63	63	80	80	100	100	100	100
500V	[A]	*	*	*	*	*	*	50	40	50	63	63	80	80	80	80	80	80
690V	[A]	*	*	*	*	*	20	35	40	50	63	63	63	63	63	63	63	63
Ultimate short-circuit breaking capacity I_{cu}																		
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	50	40	40	30	20
400/415V	[kA]	100	100	100	100	100	100	100	100	100	100	50	50	20	15	15	15	10
440/460V	[kA]	100	100	100	100	100	100	100	50	15	15	15	10	10	8	8	6	5
500V	[kA]	100	100	100	100	100	100	50	15	10	10	6	6	6	6	6	5	4
690V	[kA]	100	100	100	100	100	3	3	3	3	3	3	3	3	3	3	3	2
Rated service short-circuit breaking capacity I_{cs}																		
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	38	30	30	22	15
400/415V	[kA]	100	100	100	100	100	100	100	100	100	100	38	38	15	11	11	11	8
440/460V	[kA]	100	100	100	100	100	100	100	38	11	11	11	8	8	6	6	4	3
500V	[kA]	100	100	100	100	100	100	38	11	8	8	5	5	5	5	5	4	3
690V	[kA]	100	100	100	100	100	3	3	3	3	3	3	3	3	3	3	3	2

● MMS 63S

Rated operational current I_e	[A]	10	13	17	22	26	32	40	50	63	65
Switching of standard three-phase motors AC-2, AC-3											
230/240V	[kW]	2.2/3	3	3.7/4	4	5.5	7.5	7.5	11	15	15
400/415V	[kW]	3.7/4	5.5	7.5	7.5	11	15	18.5	22	30	30
500V	[kW]	4/5.5	7.5	11	11	15	18.5	22	30	37	37
690V	[kW]	7.5	11	11	15	18.5	22	30	45	55	55
Back-up fuses gG, gL,, only if Icc>I_{cu} (* = No back up fuse required)											
230/240V	[A]	*	*	*	125	125	160	160	160	200	200
400/415V	[A]	*	80	100	125	125	125	125	160	160	180
440/460V	[A]	80	80	100	100	100	100	100	100	125	125
500V	[A]	80	80	80	80	80	80	80	80	80	80
690V	[A]	63	63	63	63	63	63	63	63	80	60
Ultimate short-circuit breaking capacity I_{cu}											
230/240V	[kA]	100	100	100	50	50	50	50	50	50	50
400/415V	[kA]	100	50	25	25	25	25	25	25	25	25
440/460V	[kA]	15	10	10	10	10	10	10	10	10	10
500V	[kA]	10	6	6	6	6	6	6	6	6	6
690V	[kA]	4	4	4	4	4	4	4	4	4	4
Rated service short-circuit breaking capacity I_{cs}											
230/240V	[kA]	100	100	100	38	38	38	38	38	38	38
400/415V	[kA]	100	38	19	19	19	19	19	19	19	19
440/460V	[kA]	12	8	8	8	8	8	8	8	8	8
500V	[kA]	8	5	5	5	5	5	5	5	5	5
690V	[kA]	3	3	3	3	3	3	3	3	3	3

IEC performance data (Motor protection)

Standard type

● MMS 100S

Rated operational current I_e [A]		17	22	26	32	40	50	63	75	90	100
Switching of standard three-phase motors AC-2, AC-3											
230/240V	[kW]	3.7/4	4	5.5	7.5	7.5	11	15	22	30	30
400/415V	[kW]	7.5	7.5	11	15	18.5	22	30	37	45	45
500V	[kW]	11	11	15	18.5	22	30	37	45	55	63
690V	[kW]	11	15	18.5	22	30	45	55	63	75	90
Back-up fuses gG, gL,, only if Icc>I_{cu} (* = No back up fuse required)											
230/240V	[A]	*	*	*	*	*	*	*	*	*	*
400/415V	[A]	100	125	125	125	160	160	160	160	160	160
440/460V	[A]	100	125	125	125	125	125	160	160	160	160
500V	[A]	100	100	100	100	100	100	100	125	125	125
690V	[A]	63	80	80	80	80	80	80	100	125	125
Ultimate short-circuit breaking capacity I_{cu}											
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100
400/415V	[kA]	50	50	50	50	50	50	50	50	50	50
440/460V	[kA]	40	40	40	40	40	40	40	40	40	40
500V	[kA]	25	25	25	15	15	12	12	8	8	8
690V	[kA]	10	10	10	10	6	6	6	5	5	5
Rated service short-circuit breaking capacity I_{cs}											
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100
400/415V	[kA]	38	38	38	38	38	38	38	38	38	38
440/460V	[kA]	30	30	30	30	30	30	30	30	30	30
500V	[kA]	19	19	19	11	11	9	9	6	6	6
690V	[kA]	8	8	8	8	5	5	5	4	4	4

High breaking type

● MMS 32H

Rated operational current I_e [A]		0.16	0.25	0.4	0.63	1	1.6	2.5	4	6	8	10	13	17	22	26	32	40
Switching of standard three-phase motors AC-2, AC-3																		
230/240V	[kW]	-	0.03	0.06	0.09	0.12	0.18/0.25	0.37	0.55/0.75	1.1/1.5	1.5	2.2/3	3	3.7/4	4	5.5	7.5	7.5
400/415V	[kW]	0.02	0.06	0.09	0.12	0.18/0.25	0.37/0.55	0.75	1.1/1.5	2.2	3	3.7/4	5.5	7.5	7.5	11	15	1.8
500V	[kW]	-	-	-	0.25	0.37	0.55/0.75	1.1	1.5/2.2	3	3.7	4/5.5	7.5	11	11	15	18.5	22
690V	[kW]	-	-	-	0.25	0.37/0.55	0.75/1.1	1.5	2.2/3	3.7/4	5.5	7.5	11	11	15	18.5	22	30
Back-up fuses gG, gL,, only if Icc>I_{cu} (* = No back up fuse required)																		
230/240V	[A]	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
400/415V	[A]	*	*	*	*	*	*	*	*	*	*	*	*	100	125	125	125	160
440/460V	[A]	*	*	*	*	*	*	*	*	*	80	80	80	80	100	100	100	125
500V	[A]	*	*	*	*	*	*	*	*	*	63	80	80	80	80	80	80	100
690V	[A]	*	*	*	*	*	*	35	40	50	63	63	63	63	63	63	63	80
Ultimate short-circuit breaking capacity I_{cu}																		
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100
400/415V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	50	50	50	50	40
440/460V	[kA]	100	100	100	100	100	100	100	100	100	50	50	50	20	20	20	20	15
500V	[kA]	100	100	100	100	100	100	100	100	100	50	50	42	10	10	10	10	8
690V	[kA]	100	100	100	100	100	100	8	8	6	6	6	6	4	4	4	4	3
Rated service short-circuit breaking capacity I_{cs}																		
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100
400/415V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	38	38	38	38	30
440/460V	[kA]	100	100	100	100	100	100	100	100	100	38	38	38	15	15	15	15	11
500V	[kA]	100	100	100	100	100	100	100	100	100	38	38	32	8	8	8	8	6
690V	[kA]	100	100	100	100	100	100	8	8	6	6	6	6	4	4	4	4	3

Note) * = Short circuit proof up to 50 or 100kA. No back up fuse required.

High breaking type

● MMS 63H

Rated operational current I_e	[A]	10	13	17	22	26	32	40	50	63	55
Switching of standard three-phase motors AC-2, AC-3											
230/240V	[kW]	2.2/3	3	3.7/4	4	5.5	7.5	7.5	11	15	15
400/415V	[kW]	3.7/4	5.5	7.5	7.5	11	15	18.5	22	30	30
500V	[kW]	4/5.5	7.5	11	11	15	18.5	22	30	37	37
690V	[kW]	7.5	11	11	15	18.5	22	30	45	55	55
Back-up fuses gG, gL,, only if Icc>I_{cu} (* = No back up fuse required)											
230/240V	[A]	*	*	*	*	*	*	*	*	*	*
400/415V	[A]	*	*	100	125	125	125	160	160	160	160
440/460V	[A]	100	100	100	125	125	125	125	125	160	160
500V	[A]	100	100	100	100	100	100	100	100	100	100
690V	[A]	63	63	63	80	80	80	80	80	80	80
Ultimate short-circuit breaking capacity I_{cu}											
230/240V	[kA]	100	100	100	100	100	100	100	100	100	75
400/415V	[kA]	100	100	50	50	50	50	50	50	50	35
440/460V	[kA]	50	50	50	50	35	35	35	35	35	25
500V	[kA]	50	42	12	12	12	10	10	10	10	6
690V	[kA]	6	6	5	5	5	5	5	5	5	3
Rated service short-circuit breaking capacity I_{cs}											
230/240V	[kA]	100	100	100	100	100	100	100	100	100	50
400/415V	[kA]	100	100	50	50	50	50	50	50	50	27
440/460V	[kA]	38	38	38	38	27	27	27	27	27	19
500V	[kA]	38	32	9	9	9	8	8	8	8	5
690V	[kA]	5	5	5	5	5	5	5	5	5	3

Note) * = Short circuit proof up to 50 or 100kA. No back up fuse required.

● MMS 100H

Rated operational current I_e	[A]	17	22	26	32	40	50	63	75	90	100
Switching of standard three-phase motors AC-2, AC-3											
230/240V	[kW]	3.7/4	4	5.5	7.5	7.5	11	15	22	30	30
400/415V	[kW]	7.5	7.5	11	15	18.5	22	30	37	45	45
500V	[kW]	11	11	15	18.5	22	30	37	45	55	63
690V	[kW]	11	15	18.5	22	30	45	55	63	75	90
Back-up fuses gG, gL,, only if Icc>I_{cu} (*= No back up fuse required)											
230/240V	[A]	*	*	*	*	*	*	*	*	*	*
400/415V	[A]	*	*	*	*	*	*	*	*	*	*
440/460V	[A]	125	125	125	160	160	160	200	200	200	200
500V	[A]	100	125	125	125	160	160	160	160	160	160
690V	[A]	80	80	80	80	80	100	100	125	160	160
Ultimate short-circuit breaking capacity I_{cu}											
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100
400/415V	[kA]	100	100	100	100	100	100	100	75	75	75
440/460V	[kA]	50	50	50	50	50	50	50	50	50	50
500V	[kA]	35	35	35	25	20	15	15	12	12	12
690V	[kA]	12	12	12	12	12	10	8	6	6	6
Rated service short-circuit breaking capacity I_{cs}											
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100
400/415V	[kA]	100	50	50	50	50	50	50	50	50	50
440/460V	[kA]	38	38	38	38	38	38	38	38	38	38
500V	[kA]	27	27	27	19	15	11	11	9	9	9
690V	[kA]	9	9	9	9	9	8	6	6	6	6

Note) * = Short circuit proof up to 50 or 100kA. No back up fuse required.

IEC performance data (Motor protection)

High breaking type

● MMS 32HI

Rated operational current I_e	[A]	0.16	0.25	0.4	0.63	1	1.6	2.5	4	6	8	10	13	17	22	26	32	40
AC-2, AC-3																		
230/240V	[kW]	-	0.03	0.06	0.09	0.12	0.18/0.25	0.37	0.55/0.75	1.1/1.5	1.5	2.2/3	3	3.7/4	4	5.5	7.5	7.5
400/415V	[kW]	0.02	0.06	0.09	0.12	0.18/0.25	0.37/0.55	0.75	1.1/1.5	2.2	3	3.7/4	5.5	7.5	7.5	11	15	18.5
500V	[kW]	-	-	-	0.25	0.37	0.55/0.75	1.1	1.5/2.2	3	3.7	4/5.5	7.5	11	11	15	18.5	22
690V	[kW]	-	-	-	0.25	0.37/0.55	0.75/1.1	1.5	2.2/3	3.7/4	5.5	7.5	11	11	15	18.5	22	30
Back-up fuses gG, gL,, only if Icc>I_{cu} (* = No back up fuse required)																		
230/240V	[A]	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*	*
400/415V	[A]	*	*	*	*	*	*	*	*	*	*	*	*	100	125	125	125	160
440/460V	[A]	*	*	*	*	*	*	*	*	*	80	80	80	80	100	100	100	125
500V	[A]	*	*	*	*	*	*	*	*	*	63	80	80	80	80	80	80	100
690V	[A]	*	*	*	*	*	*	35	40	50	63	63	63	63	63	63	63	80
Ultimate short-circuit breaking capacity I_{cu}																		
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100
400/415V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	50	50	50	50	40
440/460V	[kA]	100	100	100	100	100	100	100	100	100	50	50	50	20	20	20	20	15
500V	[kA]	100	100	100	100	100	100	100	100	100	50	50	42	10	10	10	10	8
690V	[kA]	100	100	100	100	100	100	8	8	6	6	6	6	4	4	4	4	3
Rated service short-circuit breaking capacity I_{cs}																		
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100
400/415V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	38	38	38	38	30
440/460V	[kA]	100	100	100	100	100	100	100	100	100	38	38	38	15	15	15	15	11
500V	[kA]	100	100	100	100	100	100	100	100	100	38	38	32	8	8	8	8	6
690V	[kA]	100	100	100	100	100	100	8	8	6	6	6	6	4	4	4	4	3

● MMS 63HI

Rated operational current I_e	[A]	10	13	17	22	26	32	40	50	63	65
AC-2, AC-3											
230/240V	[kW]	2.2/3	3	3.7/4	4	5.5	7.5	7.5	11	15	15
400/415V	[kW]	3.7/4	5.5	7.5	7.5	11	15	18.5	22	30	30
500V	[kW]	4/5.5	7.5	11	11	15	18.5	22	30	37	37
690V	[kW]	7.5	11	11	15	18.5	22	30	45	55	55
Back-up fuses gG, gL,, only if Icc>I_{cu} (* = No back up fuse required)											
230/240V	[A]	*	*	*	*	*	*	*	*	*	*
400/415V	[A]	*	*	100	125	125	125	160	160	160	160
440/460V	[A]	100	100	100	125	125	125	125	125	160	160
500V	[A]	100	100	100	100	100	100	100	100	100	100
690V	[A]	63	63	63	80	80	80	80	80	80	80
Ultimate short-circuit breaking capacity I_{cu}											
230/240V	[kA]	100	100	100	100	100	100	100	100	100	75
400/415V	[kA]	100	100	50	50	50	50	50	50	50	35
440/460V	[kA]	50	50	50	50	35	35	35	35	35	25
500V	[kA]	50	42	12	12	12	10	10	10	10	6
690V	[kA]	6	6	5	5	5	5	5	5	5	3
Rated service short-circuit breaking capacity I_{cs}											
230/240V	[kA]	100	100	100	100	100	100	100	100	100	50
400/415V	[kA]	100	100	50	50	50	50	50	50	50	27
440/460V	[kA]	38	38	38	38	27	27	27	27	27	19
500V	[kA]	38	32	9	9	9	8	8	8	8	5
690V	[kA]	5	5	5	5	5	5	5	5	5	3

● MMS 100HI

Rated operational current I_e	[A]	17	22	26	32	40	50	63	75	90	100
AC-2, AC-3											
230/240V	[kW]	3.7/4	4	5.5	7.5	7.5	11	15	22	30	30
400/415V	[kW]	7.5	7.5	11	15	18.5	22	30	37	45	45
500V	[kW]	11	11	15	18.5	22	30	37	45	55	63
690V	[kW]	11	15	18.5	22	30	45	55	63	75	90
Back-up fuses gG, gL,, only if Icc>I_{cu} (* = No back up fuse required)											
230/240V	[A]	*	*	*	*	*	*	*	*	*	*
400/415V	[A]	*	*	*	*	*	*	*	*	*	*
440/460V	[A]	125	125	125	160	160	160	200	200	200	200
500V	[A]	100	125	125	125	160	160	160	160	160	160
690V	[A]	80	80	80	80	80	100	100	125	160	160
Ultimate short-circuit breaking capacity I_{cu}											
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100
400/415V	[kA]	100	100	100	100	100	100	100	75	75	75
440/460V	[kA]	50	50	50	50	50	50	50	50	50	50
500V	[kA]	35	35	35	25	20	15	15	12	12	12
690V	[kA]	12	12	12	12	12	10	8	6	6	6
Rated service short-circuit breaking capacity I_{cs}											
230/240V	[kA]	100	100	100	100	100	100	100	100	100	100
400/415V	[kA]	100	50	50	50	50	50	50	50	50	50
440/460V	[kA]	38	38	38	38	38	38	38	38	38	38
500V	[kA]	27	27	27	19	15	11	11	9	9	9
690V	[kA]	9	9	9	9	9	8	6	6	6	6

Manual motor controller (UL 508, CSA C22.2 as Manual motor controllers)

Combination Motor Controller
- Group Installation
- Type E starter

● MMS 32S

Rated operational current Ie		[A]	0.16	0.25	0.4	0.63	1	1.6	2.5	4	6	8	10	13	17	22	26	32	40
Max. short-circuit current																			
	240V	[kA]	100	100	100	100	100	100	100	100	100	100	50	50	40	30	30	20	20
	480V	[kA]	50	50	50	50	50	50	50	50	25	25	10	10	10	10	7.5	7.5	7.5
	600V	[kA]	10	10	10	10	10	10	10	5	5	5	5	5	5	5	5	5	5
Motor load																			
1 Phase	115V	[HP]	-	-	-	-	-	-	-	1/8	1/4	1/3	1/2	1/2	1	1½	2	2	3
	230V	[HP]	-	-	-	-	-	1/10	1/6	1/3	1/2	1	1½	2	3	3	3	5	7½
3 Phase	200V	[HP]	-	-	-	-	-	-	1/2	3/4	1	2	2	3	3	5	7½	7½	10
	230V	[HP]	-	-	-	-	-	-	1/2	3/4	1½	2	3	3	5	7½	7½	10	10
	460V	[HP]	-	-	-	-	-	3/4	1	2	3	5	5	7½	10	15	15	20	30
	575V	[HP]	-	-	-	-	1/2	3/4	1½	3	5	5	7½	10	15	20	20	30	30
Max. fuse size		[A]	1	1	1	1	3	6	10	15	20	30	40	50	60	80	100	125	125
Max. breaker size		[A]	15	15	15	15	15	15	15	15	20	30	40	50	60	80	100	125	125

● MMS 63S

Rated operational current Ie		[A]	10	13	17	22	26	32	40	50	63	65
Max. short-circuit current												
	240V	[kA]	100	100	100	100	100	100	100	100	100	100
	480V	[kA]	50	50	40	40	40	40	40	40	40	40
	600V	[kA]	10	10	10	10	10	10	10	10	10	10
Motor load												
1 Phase	115V	[HP]	1/2	1/2	1	1½	2	2	3	3	5	5
	230V	[HP]	1½	2	3	3	3	5	7½	10	10	10
3 Phase	200V	[HP]	2	3	3	5	7½	7½	10	15	20	20
	230V	[HP]	3	3	5	7½	7½	10	10	15	20	20
	460V	[HP]	5	7½	10	15	15	20	30	30	40	40
	575V	[HP]	7½	10	15	20	20	30	30	40	60	60
Maximum rated current of fuse or breaker		[A]	600	600	600	600	600	600	600	600	600	600

● MMS 100S

Rated operational current Ie		[A]	17	22	26	32	40	50	63	75	90	100
Max. short-circuit current												
	240V	[kA]	100	100	100	100	100	100	100	100	100	100
	480V	[kA]	50	50	50	50	50	50	40	40	40	40
	600V	[kA]	10	10	10	10	10	10	10	10	10	10
Motor load												
1 Phase	115V	[HP]	1	1½	2	2	3	3	5	5	7½	10
	230V	[HP]	3	3	3	5	7½	10	10	15	20	20
3 Phase	200V	[HP]	3	5	7½	7½	10	15	20	20	25	30
	230V	[HP]	5	7½	7½	10	10	15	20	25	30	30
	460V	[HP]	10	15	15	20	30	30	40	50	60	75
	575V	[HP]	15	20	20	30	30	40	60	60	75	100
Maximum rated current of fuse or breaker		[A]	1000	1000	1000	1000	1000	1000	1000	1000	1000	1000

In case of 1-phase use in series as shown below

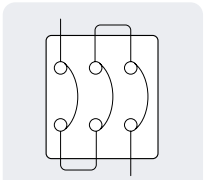

Manual motor controller (UL 508, CSA C22.2 as Manual motor controllers)

Combination Motor Controller
- Group Installation
- Type E starter

● MMS 32H

Rated operational current Ie	[A]	0.16	0.25	0.4	0.63	1	1.6	2.5	4	6	8	10	13	17	22	26	32	40
Max. short-circuit current																		
240V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100
480V	[kA]	65	65	65	65	65	65	65	65	65	65	65	65	30	30	30	30	30
600V	[kA]	25	25	25	25	25	25	25	25	25	25	25	25	10	10	10	10	10
Motor load																		
1 Phase 115V	[HP]	-	-	-	-	-	-	-	1/8	1/4	1/3	1/2	1/2	1	1½	2	2	3
230V	[HP]	-	-	-	-	-	1/10	1/6	1/3	1/2	1	1½	2	3	3	3	5	7½
3 Phase 200V	[HP]	-	-	-	-	-	-	1/2	3/4	1	2	2	3	3	5	7½	7½	10
230V	[HP]	-	-	-	-	-	-	1/2	3/4	1½	2	3	3	5	7½	7½	10	10
460V	[HP]	-	-	-	-	-	3/4	1	2	3	5	5	7½	10	15	15	20	30
575V	[HP]	-	-	-	-	1/2	3/4	1½	3	5	5	7½	10	15	20	20	30	30
Maximum rated current of fuse or breaker	[A]	500	500	500	500	500	500	500	500	500	500	500	500	500	500	500	500	500

● MMS 63H

Rated operational current Ie	[A]	10	13	17	22	26	32	40	50	63	65
Max. short-circuit current											
240V	[kA]	100	100	100	100	100	100	100	100	100	100
480V	[kA]	65	65	50	50	50	50	50	50	50	50
600V	[kA]	25	25	10	10	10	10	10	10	10	10
Motor load											
1 Phase 115V	[HP]	1/2	1/2	1	1½	2	2	3	3	5	5
230V	[HP]	1½	2	3	3	3	5	7½	10	10	10
3 Phase 200V	[HP]	2	3	3	5	7½	7½	10	15	20	20
3 Phase 230V	[HP]	3	3	5	7½	7½	10	10	15	20	20
460V	[HP]	5	7½	10	15	15	20	30	30	40	40
575V	[HP]	7½	10	15	20	20	30	30	40	60	60
Maximum rated current	[A]	600	600	600	600	600	600	600	600	600	600

● MMS 100H

Rated operational current Ie	[A]	17	22	26	32	40	50	63	75	90	100
Max. short-circuit current											
240V	[kA]	100	100	100	100	100	100	100	100	100	100
480V	[kA]	65	65	65	65	65	65	50	50	50	50
600V	[kA]	25	25	25	20	20	20	10	10	10	10
Motor load											
1 Phase 115V	[HP]	1	1½	2	2	3	3	5	5	7½	10
230V	[HP]	3	3	3	5	7½	10	10	15	20	20
3 Phase 200V	[HP]	3	5	7½	7½	10	15	20	20	25	30
230V	[HP]	5	7½	7½	10	10	15	20	25	30	30
460V	[HP]	10	15	15	20	30	30	40	50	60	75
575V	[HP]	15	20	20	30	30	40	60	60	75	100
Maximum rated current of fuse or breaker	[A]	1000	1000	1000	1000	1000	1000	1000	1000	1000	1000

In case of 1-phase use in series as shown below

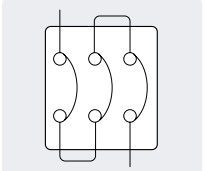

Manual Motor Controller (UL508)

● MMS 32S

Rated operational current I_e		[A]	0.16	0.25	0.4	0.63	1	1.6	2.5	4	6	8	10	13	17	22	26	32	40
Max. short-circuit current																			
	240V	[kA]	100	100	100	100	100	100	100	100	100	100	50	50	40	30	30	20	20
	480V	[kA]	50	50	50	50	50	50	50	50	25	25	10	10	10	10	7.5	7.5	7.5
	600V	[kA]	10	10	10	10	10	10	10	5	5	5	5	5	5	5	5	5	5
Motor load																			
1 Phase	115V	[HP]	-	-	-	-	-	-	-	1/8	1/4	1/3	1/2	1/2	1	1½	2	2	3
	230V	[HP]	-	-	-	-	-	1/10	1/6	1/3	1/2	1	1½	2	3	3	3	5	7½
3 Phase	200V	[HP]	-	-	-	-	-	-	1/2	3/4	1	2	2	3	3	5	7½	7½	10
	230V	[HP]	-	-	-	-	-	-	1/2	3/4	1½	2	3	3	5	7½	7½	10	10
	460V	[HP]	-	-	-	-	-	3/4	1	2	3	5	5	7½	10	15	15	20	30
	575V	[HP]	-	-	-	-	1/2	3/4	1½	3	5	5	7½	10	15	20	20	30	30
Max. fuse size		[A]	1	1	1	1	3	6	10	15	20	30	40	50	60	80	100	125	150
Max. breaker size		[A]	15	15	15	15	15	15	15	15	20	30	40	50	60	80	100	125	150

● MMS 63S

Rated operational current I_e		[A]	10	13	17	22	26	32	40	50	63	65
Max. short-circuit current												
	240V	[kA]	100	100	100	100	100	100	100	100	100	100
	480V	[kA]	25	25	25	25	25	25	25	25	25	25
	600V	[kA]	10	10	10	10	10	10	10	10	10	10
Motor load												
1 Phase	115V	[HP]	1/2	1/2	1	1½	2	2	3	3	5	5
	230V	[HP]	1½	2	3	3	3	5	7½	10	10	10
3 Phase	200V	[HP]	2	3	3	5	7½	7½	10	15	20	20
	230V	[HP]	3	3	5	7½	7½	10	10	15	20	20
	460V	[HP]	5	7½	10	15	15	20	30	30	40	40
	575V	[HP]	7½	10	15	20	20	30	30	40	60	60
Max. fuse size		[A]	40	50	60	80	100	125	150	200	250	250
Max. breaker size		[A]	40	50	60	80	100	125	150	200	250	250

● MMS 100S

Rated operational current I_e		[I_e]	17	22	26	32	40	50	63	75	90	100
Max. short-circuit current												
	240V	[kA]	100	100	100	100	100	100	100	100	100	100
	480V	[kA]	25	25	25	25	25	25	25	25	25	25
	600V	[kA]	10	10	10	10	10	10	10	10	10	10
Motor load												
1 Phase	115V	[HP]	1	1½	2	2	3	3	5	5	7½	10
	230V	[HP]	3	3	3	5	7½	10	10	15	20	20
3 Phase	200V	[HP]	3	5	7½	7½	10	15	20	20	25	30
3 Phase	230V	[HP]	5	7½	7½	10	10	15	20	25	30	30
	460V	[HP]	10	15	15	20	30	30	40	50	60	75
	575V	[HP]	15	20	20	30	30	40	60	60	75	100
Max. fuse size		[A]	60	80	100	125	150	200	250	300	350	400
Max. breaker size		[A]	60	80	100	125	150	200	250	300	350	400

In case of 1-phase use
in series as shown below

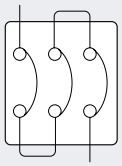

Manual Motor Controller (UL508)

● MMS 32H

Rated operational current I_e		[A]	0.16	0.25	0.4	0.63	1	1.6	2.5	4	6	8	10	13	17	22	26	32	40
Max. short-circuit current																			
	240V	[kA]	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100	100
	480V	[kA]	50	50	50	50	50	50	50	50	50	50	50	50	30	30	30	30	30
	600V	[kA]	10	10	10	10	10	10	10	10	10	10	10	10	10	10	10	10	10
Motor load																			
1 Phase	115V	[HP]	-	-	-	-	-	-	-	1/8	1/4	1/3	1/2	1/2	1	1½	2	2	3
	230V	[HP]	-	-	-	-	-	1/10	1/6	1/3	1/2	1	1½	2	3	3	3	5	7½
3 Phase	200V	[HP]	-	-	-	-	-	-	1/2	3/4	1	2	2	3	3	5	7½	7½	10
	230V	[HP]	-	-	-	-	-	-	1/2	3/4	1½	2	3	3	5	7½	7½	10	10
	460V	[HP]	-	-	-	-	-	3/4	1	2	3	5	5	7½	10	15	15	20	30
	575V	[HP]	-	-	-	-	1/2	3/4	1½	3	5	5	7½	10	15	20	20	30	30
Max. fuse size		[A]	1	1	1	1	3	6	10	15	20	30	40	50	60	80	100	125	150
Max. breaker size		[A]	15	15	15	15	15	15	15	15	20	30	40	50	60	80	100	125	150

● MMS 63H

Rated operational current I_e		[A]	10	13	17	22	26	32	40	50	63	65
Max. short-circuit current												
	240V	[kA]	100	100	100	100	100	100	100	100	100	100
	480V	[kA]	50	50	50	50	50	50	50	50	50	50
	600V	[kA]	10	10	10	10	10	10	10	10	10	10
Motor load												
1 Phase	115V	[HP]	1/2	1/2	1	1½	2	2	3	3	5	5
	230V	[HP]	1½	2	3	3	3	5	7½	10	10	10
3 Phase	200V	[HP]	2	3	3	5	7½	7½	10	15	20	20
	230V	[HP]	3	3	5	7½	7½	10	10	15	20	20
	460V	[HP]	5	7½	10	15	15	20	30	30	40	40
	575V	[HP]	7½	10	15	20	20	30	30	40	60	60
Max. fuse size		[A]	40	50	60	80	100	125	150	200	250	250
Max. breaker size		[A]	40	50	60	80	100	125	150	200	250	250

● MMS 100H

Rated operational current I_e		[I_e]	17	22	26	32	40	50	63	75	90	100
Max. short-circuit current												
	240V	[kA]	100	100	100	100	100	100	100	100	100	100
	480V	[kA]	50	50	50	50	50	50	50	50	50	50
	600V	[kA]	10	10	10	10	10	10	10	10	10	10
Motor load												
1 Phase	115V	[HP]	1	1½	2	2	3	3	5	5	7½	10
	230V	[HP]	3	3	3	5	7½	10	10	15	20	20
3 Phase	200V	[HP]	3	5	7½	7½	10	15	20	20	25	30
	230V	[HP]	5	7½	7½	10	10	15	20	25	30	30
	460V	[HP]	10	15	15	20	30	30	40	50	60	75
	575V	[HP]	15	20	20	30	30	40	60	60	75	100
Max. fuse size		[A]	60	80	100	125	150	200	250	300	350	400
Max. breaker size		[A]	60	80	100	125	150	200	250	300	350	400

In case of 1-phase use
in series as shown below

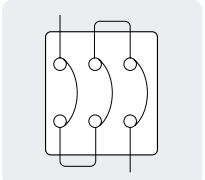

Type '2' coordination according to IEC 947-4-1

● **Short-circuit current Iq = 50kA**
Voltage : 400/415V, 50/60Hz

Standard motors AC-3 at 400/415V 1500rpm		Manual motor starter			Contactor	
		Circuit breaker	Thermal overload release setting range	Magnetic release response current		
[kW]	[A]	Type	[A]	[A]	Type	[A]
-	-	MMS-32S 0.16A	0.1~0.16	2.08	GMC-6M / GMC-9	6 / 9
0.06	0.2	MMS-32S 0.25A	0.16~0.25	3.25	GMC-6M / GMC-9	6 / 9
0.09	0.3	MMS-32S 0.4A	0.25~0.4	5.2	GMC-6M / GMC-9	6 / 9
0.12	0.4	MMS-32S 0.63A	0.4~0.63	8.19	GMC-6M / GMC-9	6 / 9
0.18	0.6	MMS-32S 0.63A	0.4~0.63	8.19	GMC-6M / GMC-9	6 / 9
0.25	0.8	MMS-32S 1A	0.63~1	13	GMC-6M / GMC-9	6 / 9
0.37	1.1	MMS-32S 1.6A	1~1.6	20.8	GMC-6M / GMC-9	6 / 9
0.55	1.5	MMS-32S 1.6A	1~1.6	20.8	GMC-6M / GMC-9	6 / 9
0.75	1.9	MMS-32S 2.5A	1.6~2.5	32.5	GMC-12	12
1.1	2.7	MMS-32S 4A	2.5~4	52	GMC-18	18
1.5	3.6	MMS-32S 4A	2.5~4	52	GMC-18	18
2.2	5.2	MMS-32S 6A	4~6	78	GMC-18	18
3	6.8	MMS-32S 8A	5~8	104	GMC-18	18
4	9	MMS-32S 10A	6~10	130	GMC-18	18
5.5	11.5	MMS-32H 13A	9~13	169	GMC-22	22
7.5	15.5	MMS-32H 17A	11~17	221	GMC-22	22
10	20	MMS-32H 22A	14~22	286	GMC-32	32
11	22	MMS-32H 26A	18~26	338	GMC-32	32
15	29	MMS-32H 32A	22~32	416	GMC-32	32
18.5	35	MMS-63H 40A	28~40	520	GMC-50	50
22	41	MMS-63H 50A	34~50	650	GMC-50	50
30	55	MMS-63H 63A	45~63	819	GMC-65	65
37	67	MMS-100S 75A	55~75	975	GMC-75	75
-	-	MMS-100S 90A	70~90	1170	GMC-85	85
45	80	MMS-100S 100A	80~100	1300	GMC-85	85

Definition type '2' coordination according to IEC 947-4-1 :

- The contactor or the starter must not endanger persons or systems in the event of a short-circuit.
- The contactor or the starter must be suitable for further use.
- No damage to the overload relay or other parts may occur with the exception of welding of the contactor or starter contacts provided that these can be easily separated without significant deformation (such as with a screwdriver).

Time/Current characteristic

MMS-32AF
Tripping Curve

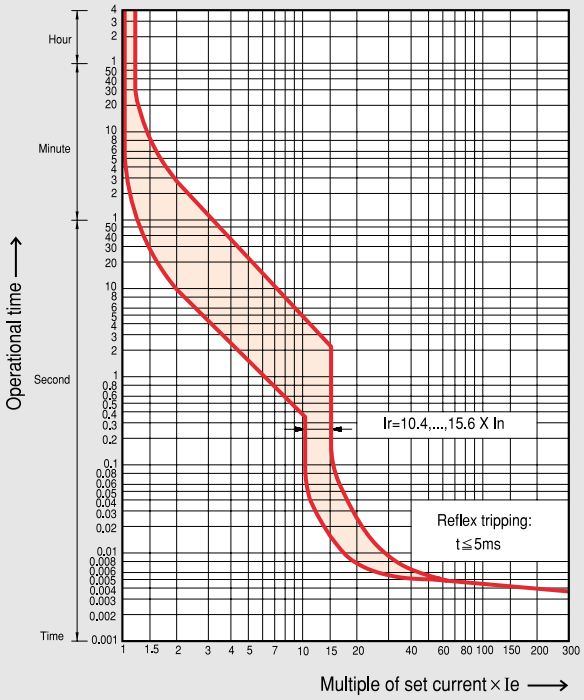

MMS-63, 100AF
Tripping Curve

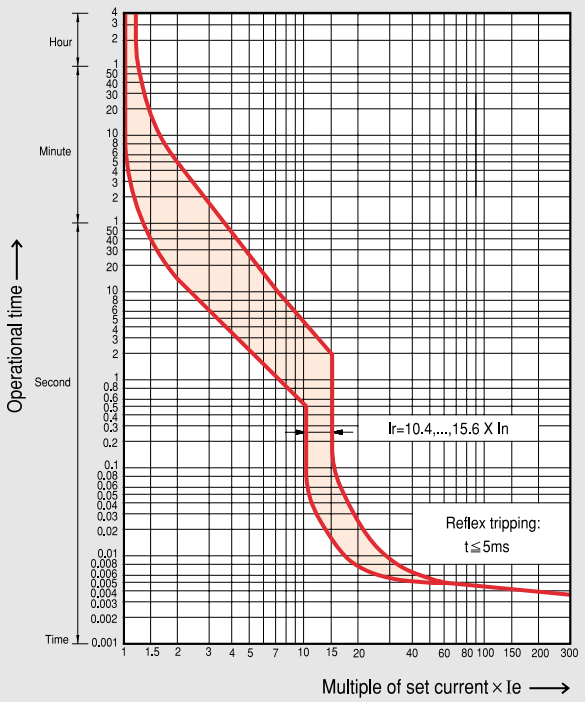

Ⅰ) Thermal release trip current :

The adjustable inverse bimetal trip reliability protects motors against overloads.
The curve shows the mean operating current at an ambient temperature of 20℃ starting from cold.
Careful testing and setting ensures effective motor protection even in the case of single-phasing.

Ⅱ) Magnetic release trip current :

The instantaneous magnetic trip has a fixed operating current setting.
This corresponds to 13times the maximum value of setting range,
at a lower setting it is correspondingly higher.

Current setting Ie :

The overload trip corresponds to a thermal overload relay in a motor starter conforming to IEC 947-4-1.
If a different value is prescribed (e.g. reduced Ie for cooling medium having a temperature higher
than 40℃ or a place of installation higher than 2000m above sea level),
the setting current is equal to the reduced rated current Ie of the motor.

Thermal limit on short circuit for MMS

Thermal limit in kA²s in the magnetic operating zone (Ue=415V)

● **MMS-32S/H/HI**

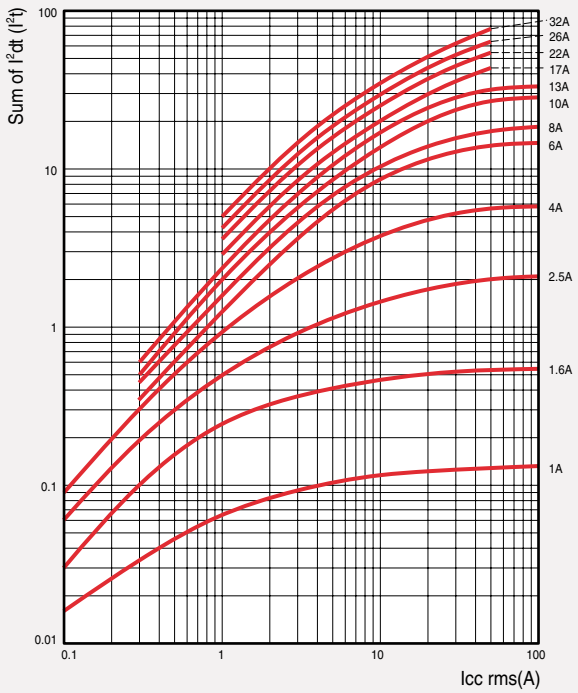

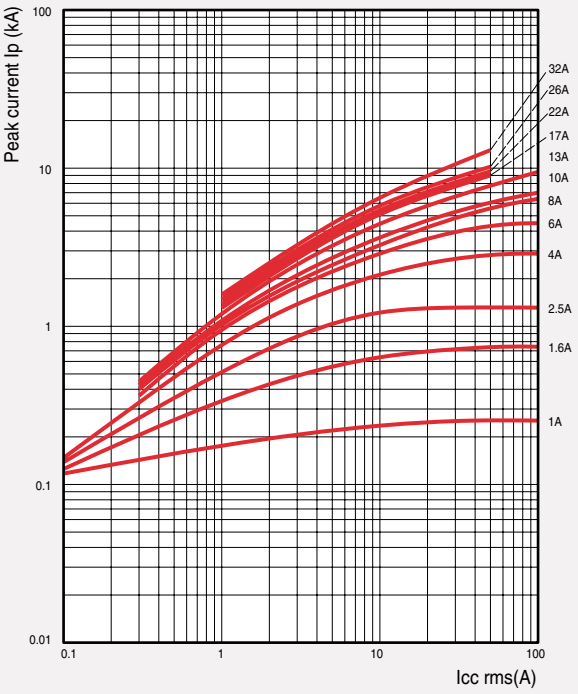

Thermal limit on short circuit for MMS

Thermal limit in kA^2s in the magnetic operating zone (Ue=415V)

● **MMS-63S/H/HI**

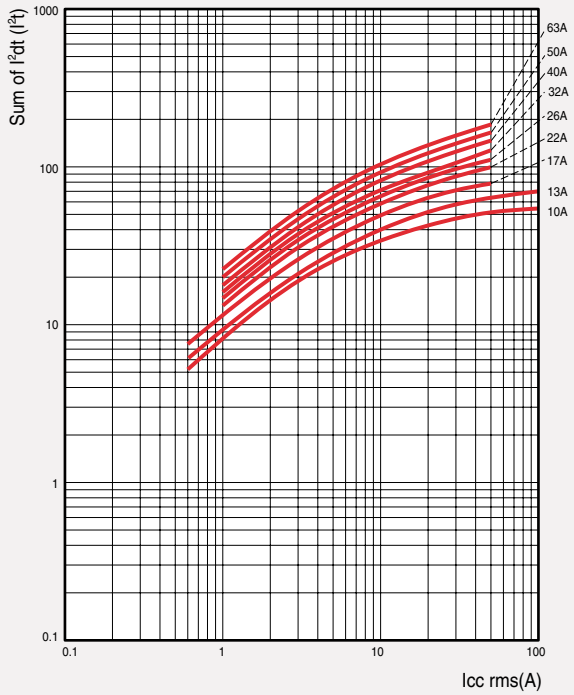

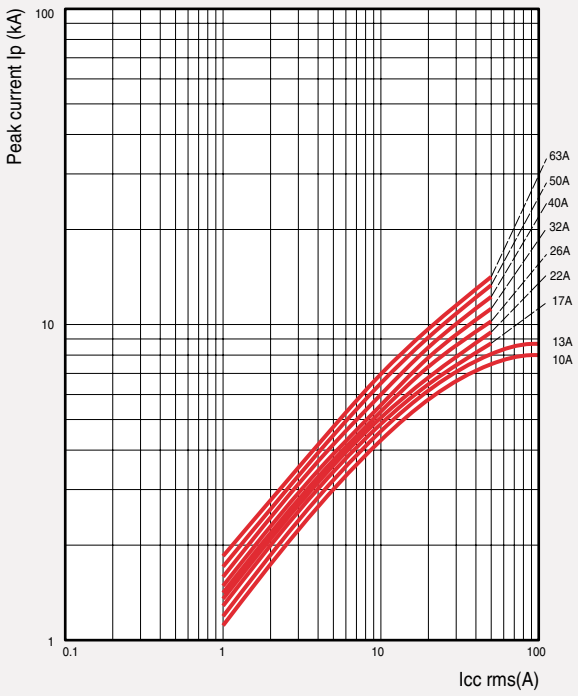

Dimensions

● MMS 32S

[mm]

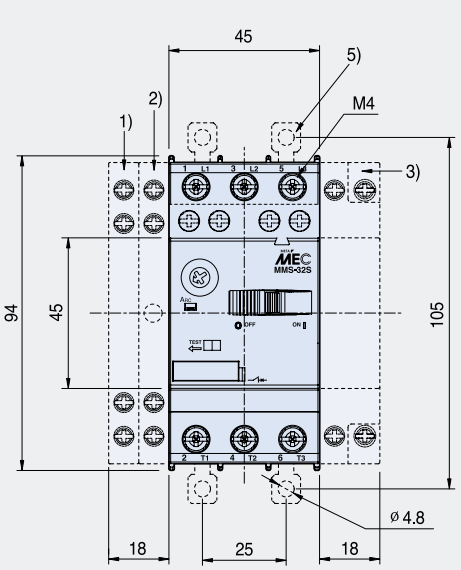

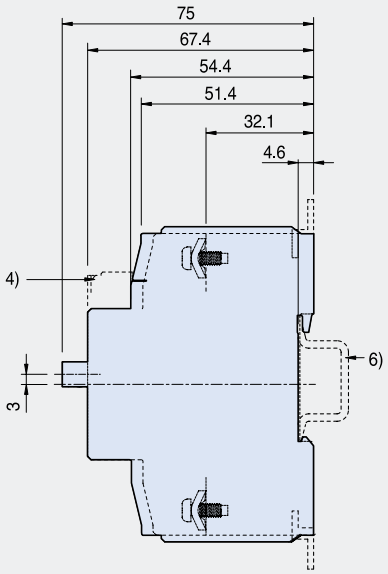

0.32kg

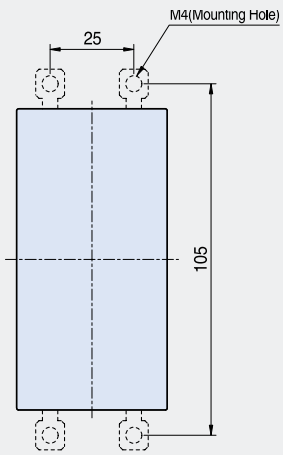

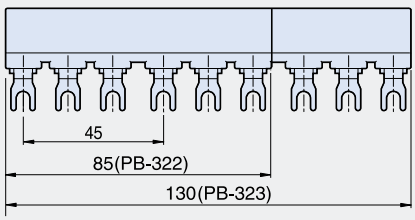

MMS-32S+PB-32(2,3 Terminal)
PB-322(2 Terminal), PB-323(3 Terminal)

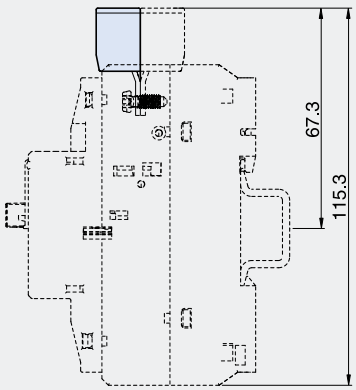

1) Side auxiliary switch
2) Side magnetic trip alarm switch
3) Side shunt release or Side undervoltage release
4) Front auxiliary switch
5) Push-in Lugs for screw mounting
6) 35㎜ standard mounting rail acc. to EN 50 022

Dimension

● **MMS 32H, 32HI** [mm]

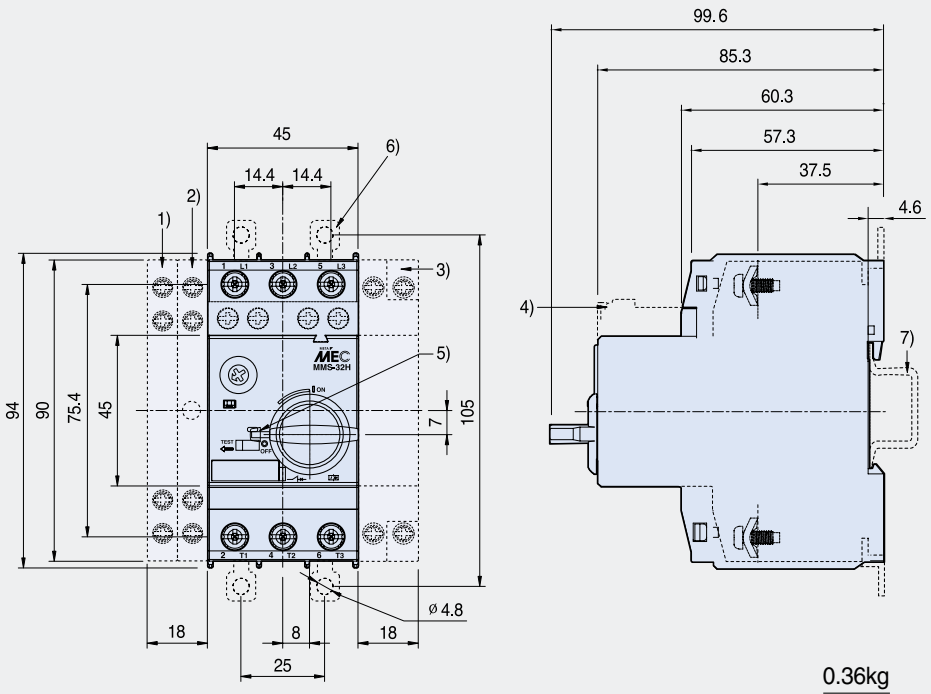

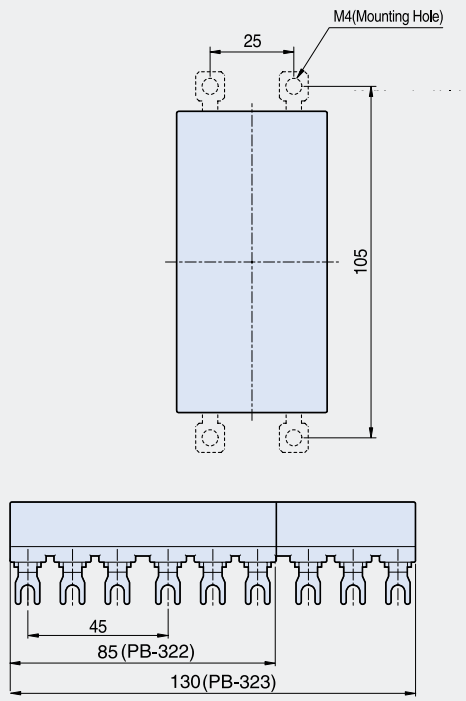

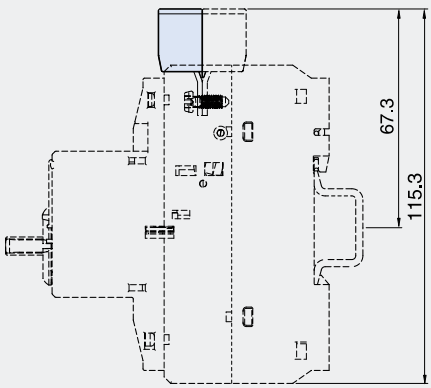

MMS-32H/HI+PB-32(2,3 Terminal)
PB-322(2 Terminal), PB-323(3 Terminal)

1) Side auxiliary switch
2) Side magnetic trip alarm switch
3) Side shunt release or Side undervoltage release
4) Front auxiliary switch
5) Handle lock in OFF position(ø 5㎜)
6) Push-in Lugs for screw mounting
7) 35㎜ standard mounting rail acc. to EN 50 022

● MMS 63S, 63H, 63HI

[mm]

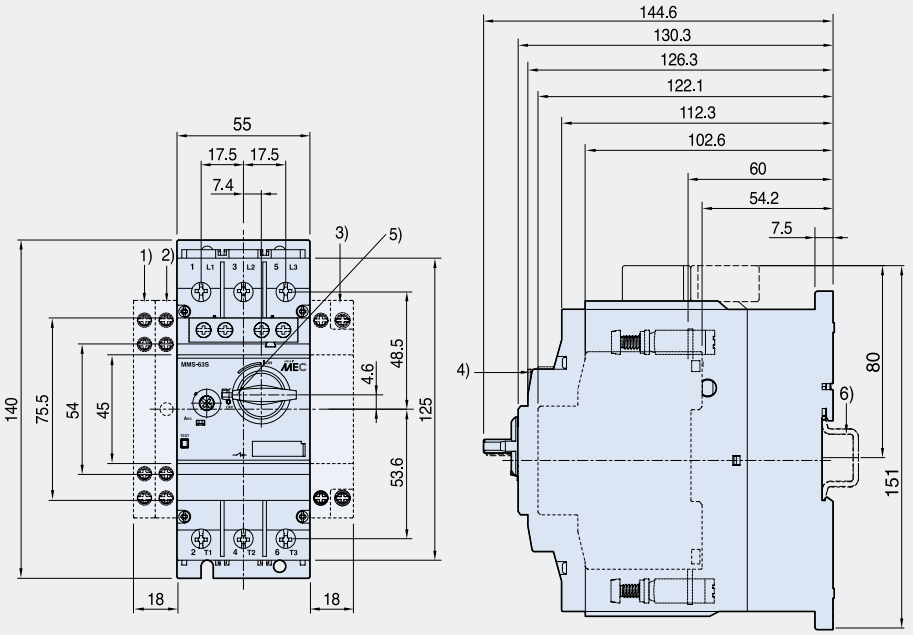

1kg

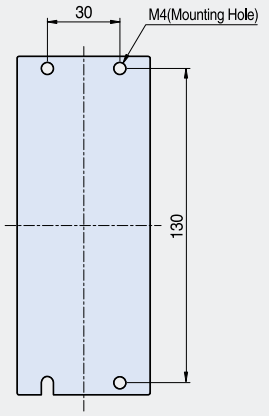

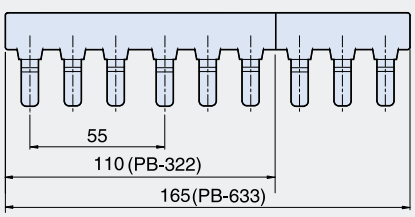

MMS-63S/H/HI+PB-63(2,3 Terminal)
PB-632(2 Terminal), PB-633(3 Terminal)

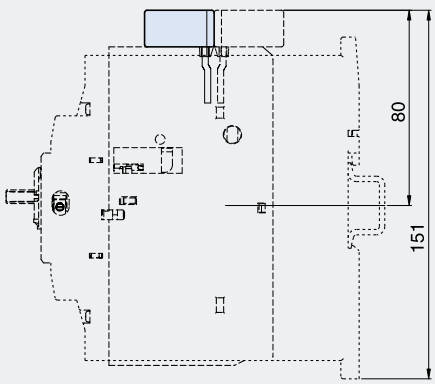

1) Side auxiliary switch
2) Side magnetic trip alarm switch
3) Side shunt release or Side undervoltage release
4) Front auxiliary switch
5) Handle lock in OFF position(ø 5㎜)
6) 35㎜ standard mounting rail acc. to EN 50 022

Dimension

● MMS 100S, 100H, 100HI

[mm]

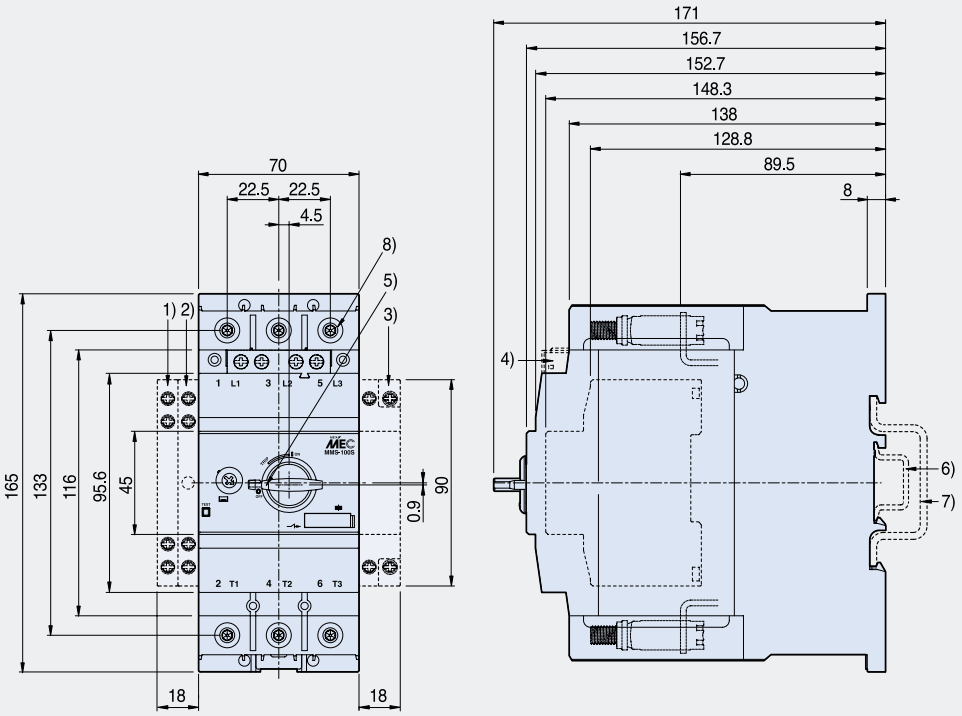

2.2kg

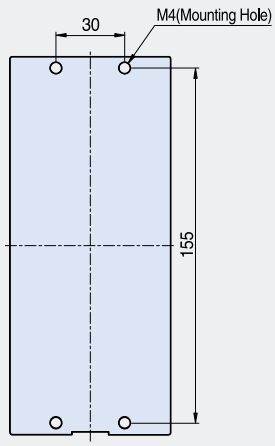

1) Side auxiliary switch
2) Side magnetic trip alarm switch
3) Side shunt release or Side undervoltage release
4) Front auxiliary switch
5) Handle lock in OFF position(ø 5㎜)
6) 35㎜ standard mounting rail acc. to EN 50 022
7) 75㎜ standard mounting rail acc. to EN 50 023
8) 4㎜ hexagon socket screw

● MMS + Mini-MS

[mm]

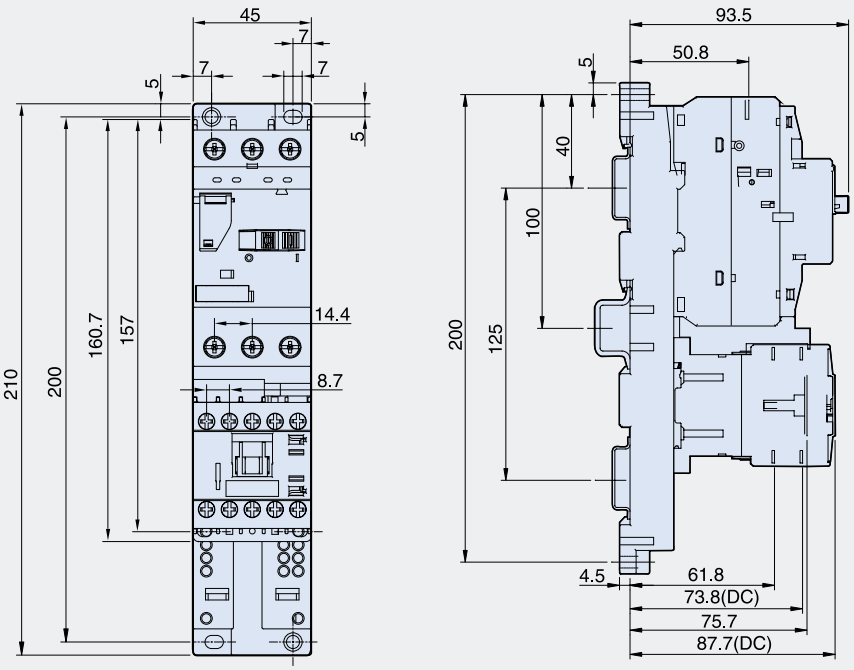

MMS-32S+GMC(D)-6M~16M

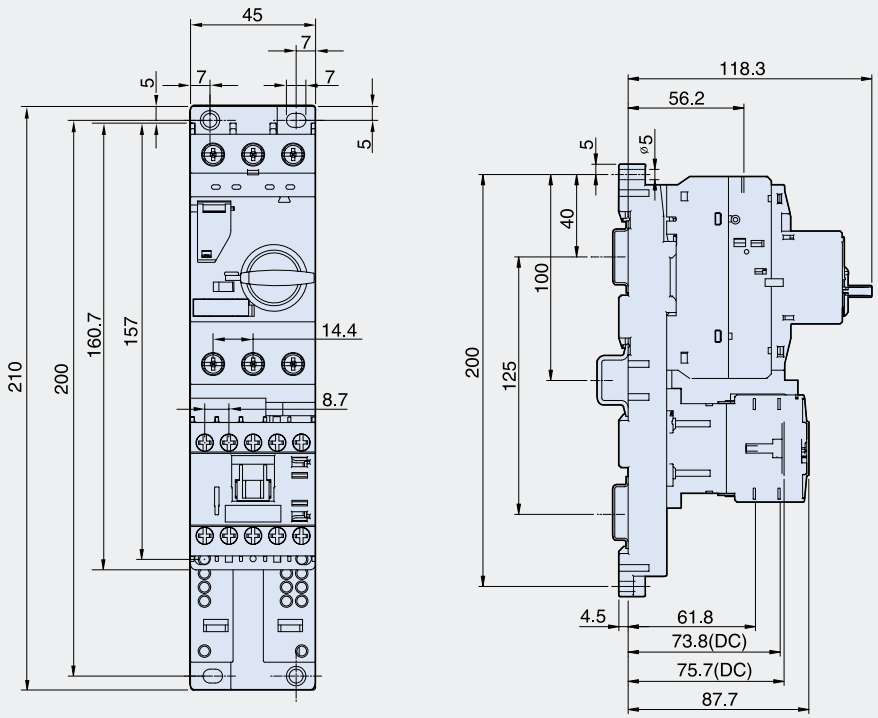

MMS-32H+GMC(D)-6M~16M

Dimension

● MMS + Susol MC

[mm]

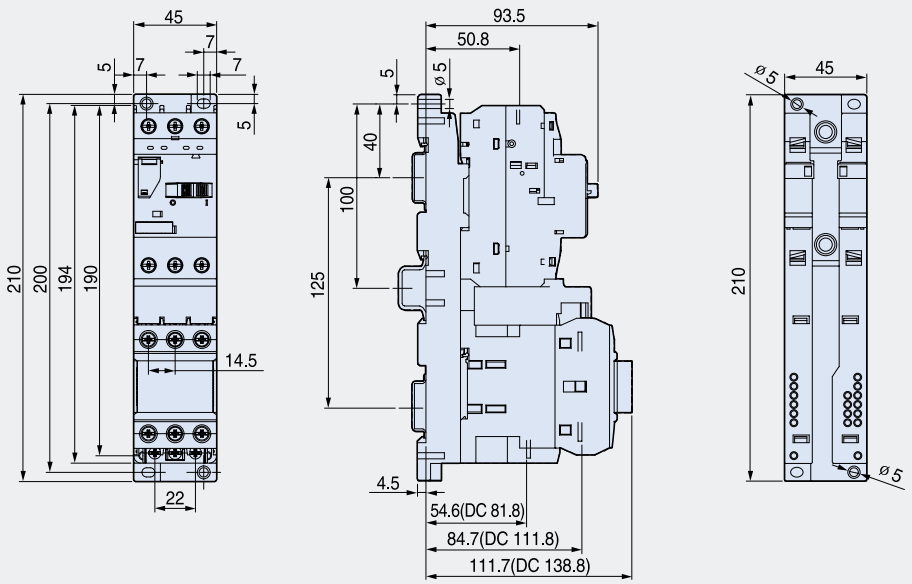

MMS-32S
+
MC-32AF

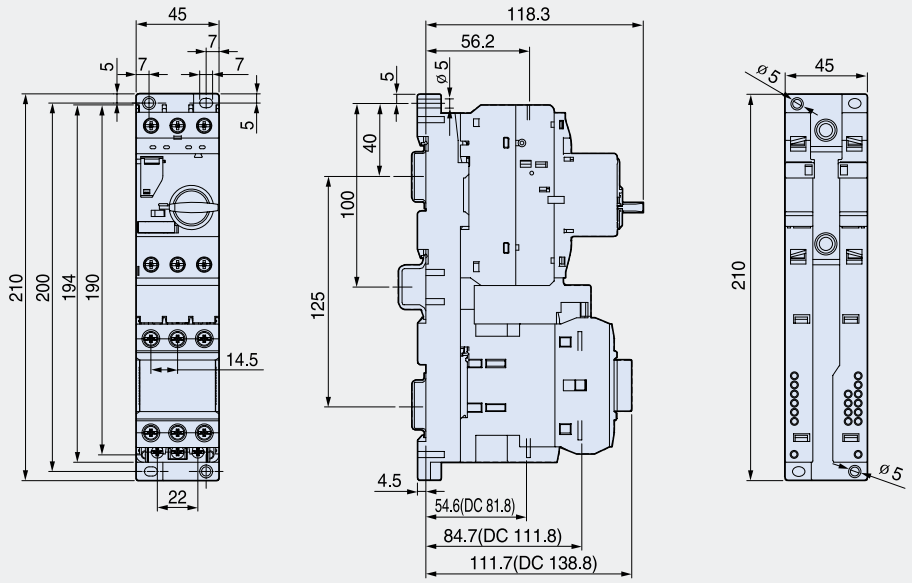

MMS-32H
+
MC-32AF

● MMS + Susol MC

[mm]

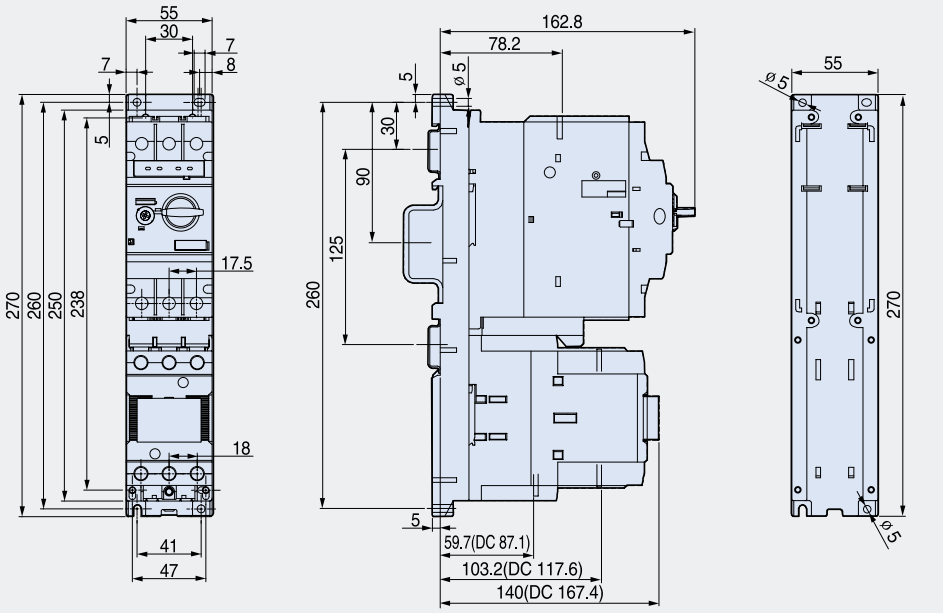

MMS-63H
+
MC-63AF

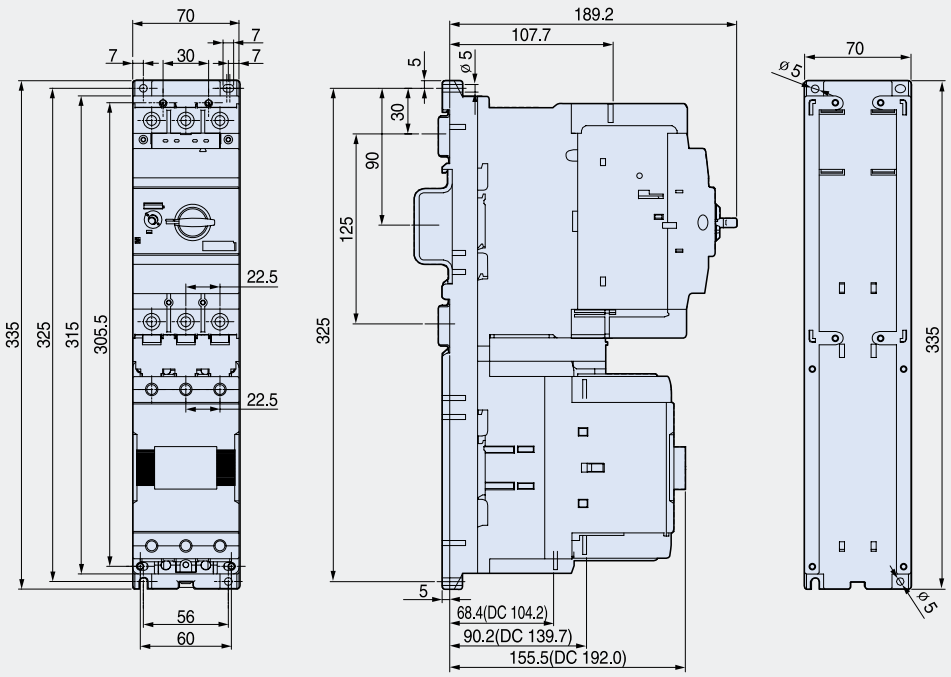

MMS-100H
+
MC-95AF

Dimension

● E-Handle

[mm]

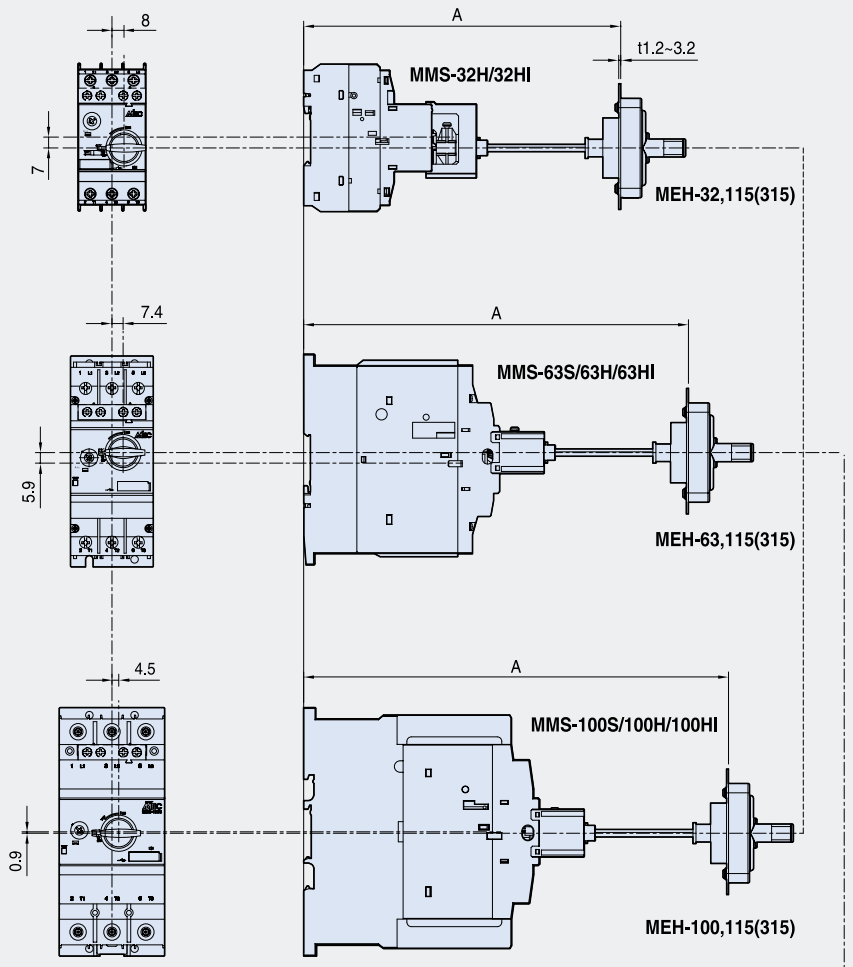

E-Handle Type	A(mm)	MMS Type
MEH-32, 115	min : 148.6	MMS-32H/32HI
	max:210.6(Shaft 115mm)	
MEH-32, 315	min : 148.6	
	max:410.6(Shaft 315mm)	
MEH-63, 115	min : 193.6	MMS-63S/63H/63HI
	max:255.6(Shaft 115mm)	
MEH-63, 315	min : 193.6	
	max:455.6(Shaft 315mm)	
MEH-100, 115	min : 220	MMS-100S/100H/100HI
	max:282(Shaft 115mm)	
MEH-100, 315	min : 220	
	max:482(Shaft 315mm)	

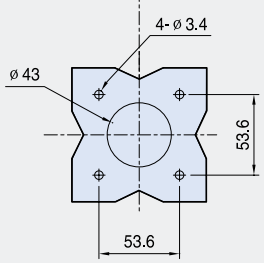

● Enclosure

[mm]

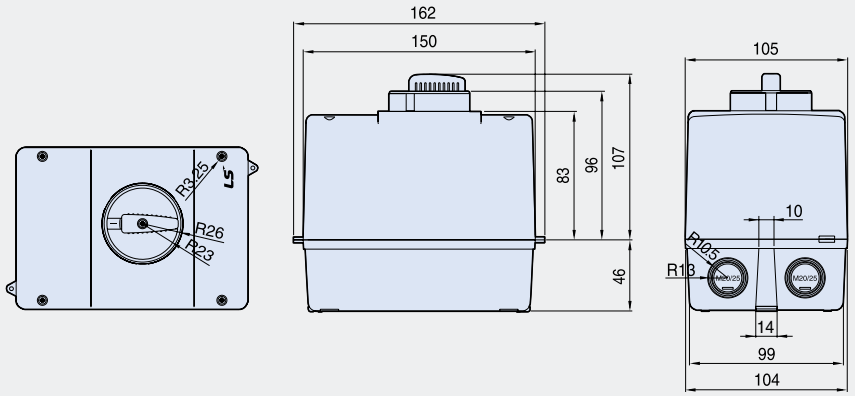

● Phase Bus

PB-322/323

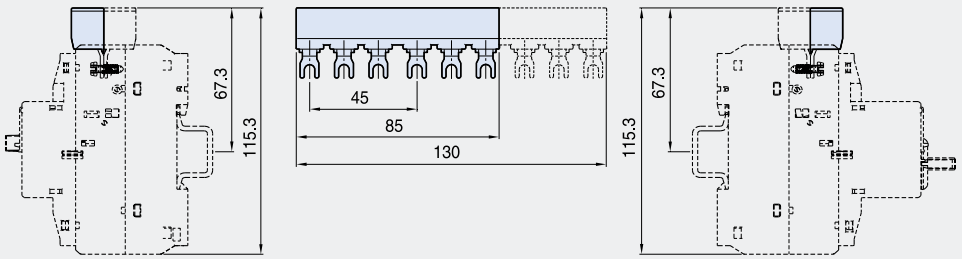

PB-632/633

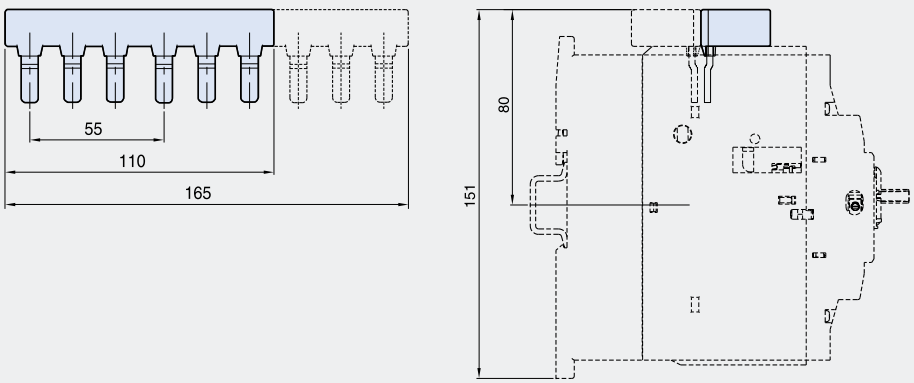

Leader in Electrics & Automation

Safety Instructions

- For your safety, please read user's manual thoroughly before operating.
- Contact the nearest authorized service facility for examination, repair, or adjustment.
- Please contact a qualified service technician when you need maintenance.
  Do not disassemble or repair by yourself!
- Any maintenance and inspection shall be performed by the personnel having expertise concerned.

© 2003.12 LS Industrial Systems Co.,Ltd. All rights reserved.

LS Industrial Systems Co., Ltd.

www.lsis.biz

HEAD OFFICE

LS Tower, 1026-6 Hokyeh 1dong, Dongan-gu, Anyang,
Kyonggi-Do, 431-848, Korea
Tel. (82-2)2034-4940~8
Fax. (82-2)780-0382

CHEONG-JU PLANT

Cheong-Ju Plant #1, Song Jung Dong, Hung Duk Ku,
Cheong Ju, 361-720, Korea

Specifications in this catalog are subject to change without notice due to continuous product development and improvement.

Global Network

- **LS Industrial Systems (Middle East) FZE » Dubai, U.A.E.**
  Address: P.O.Box-114216, API World Tower, 303B, Sheikhe Zayed Road, Dubai, U.A.E.
  Tel: 971-4-332-8289 Fax: 971-4-332-9444 e-mail: hwyim@lsis.biz
- **Dalian LS Industrial Systems Co., Ltd. » Dalian, China**
  Address: No.15, Liaohexi 3-Road, Economic and Technical Development zone, Dalian 116600, China
  Tel: 86-411-8273-7777 Fax: 86-411-8730-7560 e-mail: lixk@lsis.com.cn
- **LS Industrial Systems (Wuxi) Co., Ltd. » Wuxi, china**
  Address: 102-A , National High & New Tech Industrial Development Area, Wuxi, Jiangsu,214028, P.R.China
  Tel: 86-510-8534-6666 Fax: 86-510-522-4078 e-mail: xuhg@lsis.com.cn
- **LS-VINA Industrial Systems Co., Ltd. » Hanoi, Vietnam**
  Address: Nguyen Khe - Dong Anh - Ha Noi - Viet Nam
  Tel: 84-4-882-0222 Fax: 84-4-882-0220 e-mail: srjo@lsisvina.com
- **LS Industrial Systems Tokyo Office » Tokyo, Japan**
  Address: 16FL, Higashi-Kan, Akasaka Twin Tower 17-22, 2-chome, Akasaka, Minato-ku Tokyo 107-8470, Japan
  Tel: 81-3-3582-9128 Fax: 81-3-3582-2667 e-mail: jschuna@lsis.biz
- **LS Industrial Systems Shanghai Office » Shanghai, China**
  Address: Room E-G, 12th Floor Huamin Empire Plaza, No.726, West Yan'an Road Shanghai 200050, P.R. China
  Tel: 86-21-5237-9977 (609) Fax: 89-21-5237-7191 e-mail: jinhk@lsis.com.cn
- **LS Industrial Systems Beijing Office » Beijing, China**
  Address: B-Tower 17FL.Beijing Global Trade Center B/D. No.36, BeiSanHuanDong-Lu, DongCheng-District, Beijing 100013, P.R. China
  Tel: 86-10-5825-6025,7 Fax: 86-10-5825-6026 e-mail: cuixiaorong@lsis.com.cn
- **LS Industrial Systems Guangzhou Office » Guangzhou, China**
  Address: Room 1403,14F,New Poly Tower,2 Zhongshan Liu Road,Guangzhou, P.R. China
  Tel: 86-20-8326-6764 Fax: 86-20-8326-6287 e-mail: linsz@lsis.com.cn
- **LS Industrial Systems Chengdu Office » Chengdu, China**
  Address: 12Floor, Guodong Buiding, No52 Jindun Road Chengdu, 610041, P.R. China
  Tel: 86-28-8612-9151 Fax: 86-28-8612-9236 e-mail: yangcf@lsis.com.cn
- **LS Industrial Systems Qingdao Office » Qingdao, China**
  Address: 7B40,Haixin Guangchang Shenye Building B, No.9, Shandong Road Qingdao 26600, P.R. China
  Tel: 86-532-8501-6568 Fax: 86-532-583-3793 e-mail: lirj@lsis.com.cn

2008. 09

Manual Motor Starters (E) 2003. 12/(18) 2008. 09 Printed in Korea STAFF